

FIRST RE-ESTABLISHMENT

GCDB 400400

Section corner for Sections 16, 15, 21, and 22.

Found: One bearing tree remaining, all other bearing trees and the brass cap have been destroyed by construction of a skid trail.

The corner point, located at record bearing and distance from the N.E. bearing tree marked by Cadastral Engineers in 1955:

- A 13-inch now 16-inch Douglas Fir bears N59 $\frac{3}{4}$ °E, 24.4 feet, with "32S R1W S15 BT" visible on partially healed blaze. Falls on a steep slope.

We set: Brass cap as a witness corner, 30.0 feet North of the true corner, marked:

COUNTY SURVEYORS OFFICE

T32S R1W	
Wit.	Cor.
S 16	S 15
<hr/>	
S 21	S 22

30 feet South to Corner.

We marked the following bearing trees for the witness corner:

- 13-inch Douglas Fir bears N82°W, 9.0 feet scribed "WC T32S R1W S16 CS BT"
- 36-inch Douglas Fir bears N53°E, 55.6 feet scribed "WC T32S R1W S15 CS BT"

Douglas County Surveyor
Roseburg, OR
June 4, 1974