

FIRST RE-ESTABLISHMENT

DLC75SSE

GCDB 864100

NE corner of DLC #64, (Also SSE DLC #75) Township 38 South, Range 1 West.

Found a 6"x 12"x 18" stone with X on top set for corner, also found remains of Yellow Pine stump corresponding to the original bearing tree to the northwest.

At the exact location of said X on stone:

- Set a 1½"x 36" galvanized iron pipe for corner. On top of said pipe, set an 8"x12"x10" basalt stone with cross on top directly above said pipe corner.

From which:

- A 1½"x 36" galvanized iron pipe at the northwest corner of DLC #69 bears N0°07'E, 72.62 feet.
- A 2"x 2"x 30" iron angle bar (set 2' west of a power pole) bears N68°15'E, 163.0 feet.
- Set a 2"x 2½"x 36" iron angle bar 1.5 feet south of a power pole which bears N71°35'W, 87.5 feet.

December 29, 1938
C. Z. Boyden,
Deputy County Surveyor

C. I. Bourne
A. H. Smith

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

DLC75SSE

GCDB 864100

Northeast corner DLC #64, and South Southeast corner DLC #75, Township 38 South, Range 1 West, W.M.

Found 12 inches below the surface of the ground, brass cap imbedded in concrete marked:

DLC		
75		
-----		DLC
NE COR		69
DLC		
64		
1973		

The single remaining reference, noted on First re-establishment in 1938, the (since re-established Northwest corner of DLC No. 69 bears N00°05'E, 72.65 feet. Record: N00°07'E, 72.62 feet.

I take new references as follows:

- The most Easterly corner of concrete foundation of metal building bears S72°40'W, 77.75 feet.
- The Northeast corner of a 9x12 feet concrete block house, bears S16°43'W, 111.43 feet.

See 1979 field notes, page 50, for origin of found monument.

April 3, 1979
J. Swanson
R. Frost

Approved by: Edward McGinty
County Surveyor

SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

DLC75SSE

GCDB 864100

Northeast corner of Donation Land Claim No. 64, and South Southeast corner of Claim No. 75, located in Section 23, Township 38 South, Range 1 West, W.M.

Found 2½-inch diameter damaged brass cap on a ¾ inches iron pipe set in concrete, as found on Second Re-establishment, dated 1979.

This monument has been moved from its original position due to fence construction.

Moved corner back to original location and set a 2½-inch diameter brass cap in the top of ¾-inch diameter pipe marked:

T38SR1W
DLC
—
NE
64
CS
1992

Pounded concrete around monument.

The Northwest corner of DLC 69, bears N0°11'13"E, 72.65 feet. Record (1979) N0°05'E. Record on Survey No. 13267 dated 1992, bears N0°11'13"E, 72.63 feet.

The only usable reference taken in 1979 found:

- The Northeast corner of a 9x12 feet concrete block building bears S16°46'30"W, 111.45 feet. Record: S16°43'W, 111.43 feet.

New references:

- ⅝-inch rebar projecting 2 inches with yellow plastic cap marked "L.J.Friar-Associates" bears Record: N0°11'13"E, 30.10 feet.
- A 2-inch diameter cyclone fence post set in concrete on north-south fence bears N8°15'20"E, 10.47 feet. **Note:** This is the 5th post south from highway right-of-way.

Corner lies 1.5 feet west of cyclone fence.

December 30, 1992
T. Newcomb, Tech.
J. Burgess, tech.

Verlyn Thomas
County Surveyor

P. -176