

FIRST RE-ESTABLISHMENT

GCDB 400100

Section Corner on Township Line - Sections 33 and 34, Township 35 South, Range 2 West and Sections 4 and 3, Township 36 South, Range 2 West.

Found standard Army Engineer's concrete monument with 3½" bronze disc set for corner 6" below surface of the county road,

From which:

- The original bearing tree, a 30" ash, bears S.18½°W. 189.7 feet.
- Also found remains of pine BT to northeast.
- Set a ½" x 24" iron pin which bears N.89°56'E. 100.0 feet.
- The southwesterly edge of a 24" concrete pipe which encircles a spring bears N.21°E. 241.1 feet.
- Set a ¾" x 24" iron pin which bears West 40.0 feet.
- A ¾" x 25" iron pin bears S.89°56' W. 30.0 feet.

L. J. Shorey
B. L. Campbell

October 18, 1944
C. Z. Boyden

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

GCDB 400100

Section corner common to Sections 33 and 34, Township 35 South, Range 2 West, and Sections 3 and 4, Township 36 South, Range 2 West, W.M.

Found 21 ins. below asphalt road surface, the Army Engineer's brass cap in concrete noted on first re-establishment (page 12) in 1944.

Note: Evidence from which the above was set is unknown.

References recorded on first re-establishment found as follows:

- $\frac{3}{8}$ ins. iron pin (bolt?) with nut, 5 ins. deep, located on East-West fence line, brs. Record: N89°56'E, 100.00 feet.
- $\frac{3}{4}$ ins. iron pin, 12 ins. deep, brs. S89°50'W, 30.05 feet. Record: S89°56'W, 30.0 feet.
- $\frac{3}{8}$ ins. diam. iron pin, 15 ins. deep, brs. S89°52'W, 40.05 feet. Record: West, 40.0 feet.
- A found $\frac{5}{8}$ ins. diam. smooth iron pin brs. S18°07'W, 125.54 feet. This pin located on North- South fence line, reference Survey No. 5363.

I set a 1x36 ins. G.I. pipe, 35 ins. in the ground with a yellow plastic cap marked "JACKSON C.S." brs. N89°56'E, 30.12 feet.

See also Jackson County Project File No. 79-5 IN MON CASE.

January 22, 1979
B. Malotte
R. Frost

Approved by: Edward McGinty
County Surveyor


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

GCDB 400100

Section corner common to Sections 33 and 34, Township 35 South, Range 2 West, and Sections 3 and 4, Township 36 South, Range 2 West, W.M.

Found 6 ins. below asphalt road surface in 4 ins. diameter pvc sleeve, an unrecorded 3 ins. diameter brass cap, marked:

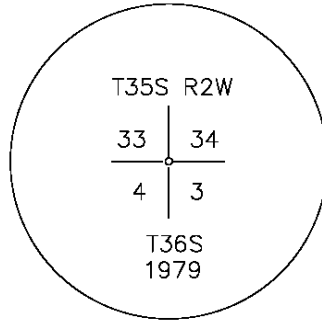

References per Second Re-establishment dated 1979, found:

- $\frac{3}{8}$ ins. iron bolt with nut, 6 ins. deep, located in East-West bearing fence line, bears $N89^{\circ}43'21''E$, 99.96 feet. Record: $N89^{\circ}56'E$, 100.00 feet.
- 1 ins. diameter iron pipe with yellow plastic cap marked "Jackson County", 3 ins. deep, leaning southeasterly, bears $S89^{\circ}22'25''E$, 30.66 feet. Record: $N89^{\circ}56'E$, 30.12 feet.

Set new references, 5/8 x 24 ins. rebar with 2 ins. diameter aluminum caps marked "Jackson County Surveyor":

- Flush in gravel shoulder of Tresham Ln., 4.5 feet north of asphalt edge, bears $N87^{\circ}33'06''W$, 286.42 feet.
- Flush in gravel shoulder of Table Rock Rd., 12 feet east of asphalt edge, bears $S13^{\circ}52'12''E$, 118.60 feet.

Set new references, 1 ins. diameter brass plug marked "CS":

- Flush in northwest corner of concrete pad for electric transformer, bears $N69^{\circ}12'07''E$, 43.80 feet.
- Flush in top of concrete culvert end, 42 feet northwest of stop sign, bears $S47^{\circ}15'26''W$, 78.60 feet.

Corner is located near approx. physical centerline of Table Rock Rd., at the intersection with the approx. projected physical centerline of Tresham Ln.

Basis of Bearing: NAD83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-00015

July 11, 2019
O. Ribanszky
J. Hall

Scott Fein
County Surveyor