

## PROPORTIONED CORNER

GCDB 100300

Section Corner on Willamette Meridian, Sections 24 and 25, Township 36 South, Range 1 West and Sections 19 and 30, Township 36 South, Range 1 East.

Set a 2" x 33" iron pipe 5" below the surface of the county road for corner on single proportion distance from the section corner approximately 1 mile South and approximately 3½ miles North.

- Set a 5/8" x 20" iron pin which bears West 40.0 feet.
- Set a 5/8" x 22" iron pin which bears East 40.0 feet.
- West 24.7 feet to center wire of a 3 wire transmission line.
- Nail in corner post of fences North and East bears N 50°E, 51.56 feet.

April 5, 1945  
C. Z. Boyden  
R. E. Welch  
F. Foley  
L. J. Shorey

PROPORTIONED CORNER – NO FIRST RE-ESTABLISHMENT

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

## SECOND RE-ESTABLISHMENT

GCDB 100300

Section corner common to Sections 24 and 25, Township 36 South, Range 1 West, and Section 19 and 30, Township 36 South, Range 1 East, W.M.

Found the 2" pipe corner monument and the  $\frac{5}{8}$ " iron pins as reported in the First re-establishment by Deputy County Surveyor C. Z. Boyden on April 5, 1945.

Replaced the 2" pipe with a 1" x 36" galvanized iron pipe set 3" below the surface of the pavement of Antelope Road, with a 2½" bronze cap stamped:

	T36S	
R1W 24		19 R1E
25		30
C.S.		
1964		

From which:

- A  $\frac{5}{8}$ " iron pin (found) bears Westerly 39.95 feet.
- A  $\frac{5}{8}$ " iron pin (found) bears Easterly 40.23 feet.
- Set a  $\frac{5}{8}$ " x 24" iron pin which bears South  $53\frac{1}{4}^\circ$ W, 57.64 feet.
- A nail in Power Pole No. B-10353 bears South  $41\frac{1}{2}^\circ$ E, 57.29 feet.

December 22, 1964  
F.A. Roberts  
L. Hart

L. D. Pinkham  
Deputy County Surveyor


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

### THIRD RE-ESTABLISHMENT

#### GCDB 100300

Section corner common to Sections 24 and 25, Township 36 South, Range 1 West, and Sections 19 and 30, Township 36 South, Range 1 East, W.M.

Found, in monument case, 4 ins. below asphalt surface of Meridian Road, as recorded, brass cap, 2½ ins. diam., marked:

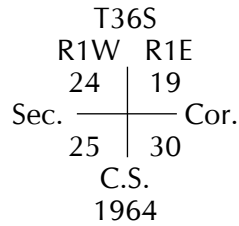

On second re-establishment, dated 1964.

For origin of this (proportionate) corner set (First Re-establishment) dated 1945.

References noted in 1964 found as follows:

- Iron pin 5/8-ins. diam., found 4 ins. deep with top bent, brs. S89°44'E, 40.17 feet. Record; East, 40.23 feet.
- Iron pin 5/8-ins. diam., found flush, brs. S56°49'W, 57.64 feet. Record; S53¾°W.
- Iron pin, 5/8-ins. diam., found projecting 4 ins., brs. N88°57'W, 40.14 feet. Record; Westerly, 39.95 feet.

To perpetuate this location, set tack in lead plug at top of most southerly ends of concrete irrigation box culvert br.:

- N22°39'E, 105.15 feet.
- N9°02'W, 54.04 feet.

Center of found brass cap (Bureau of Reclamation Bench Mark) located in above noted structure, brs. N7°40'W, 70.23 feet.

January 19, 1981  
R. Frost  
R. Templin

Edward McGinty  
County Surveyor

V = 19½°  
P. -13