

FIRST RE-ESTABLISHMENT

GCDB 300700

Corner on Township line - Sections 32 & 33, Township 34 South, Range 2 West and Sections 4 & 5, Township 35 South, Range 2 West.

Found:

- Original BTs to Northwest and Southwest lying down with scribe visible.
- BT to Southeast standing; no scribe visible.
- Also stump hole of BT to Northeast.

From which evidence, set a $\frac{5}{8}$ " x 30" iron pin 28" in the ground for corner.

From which:

- A 26" white oak scribed CS-BT bears N.3¼°W., 59.4 feet.
- Scribed a 12" white oak CS-BT which bears N.59°E., 69.0 feet.
- Scribed a 10" white oak CS-BT which bears S.10½°W., 31.3 feet.

November 27, 1944
C. Z. Boyden
B. L. Campbell
R. E. Welch

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

GCDB 300700

Corner common to Sections 32 and 33, T34S, R2W and Sections 4 and 5, Township 35 South, Range 2 West, W.M.

Found the $\frac{5}{8}$ " iron pin set for corner on the First Re-establishment by Deputy County Surveyor, C. Z. Boyden on November 27, 1944.

Drove a 1"x36" galvanized iron pipe over said pin with a 2½" bronze cap stamped:

T34-35SR2W	
32	33
Sec	Cor.
5	4
C.S.	
1971	

35" in the ground for corner.

From which:

- The stump holes of the original bearing trees to the Northwest and Southeast (with remains of the trees on the ground) agree favorably with the Government Record.
- The 1944 Re-establishment tree (now a 12" White Oak with healed faces) bears $S10\frac{1}{2}^{\circ}W$, 31.6 feet to the center of the tree;
- The 1944 Re-establishment tree (now an 28" White Oak with healed faces) bears $N3\frac{1}{4}^{\circ}W$, 60.3 feet to the center of the tree;
- The 1944 Re-establishment tree (now an 18" White Oak with healed faces) bears $N58\frac{1}{2}^{\circ}E$, 69.8 feet to the center of the tree.
- Found a 9" White Oak (scribed CS in the upper blaze) which bears $S71^{\circ}E$, 32.4 feet to the face of the upper blaze.
- This tree was reported in C. Z. Boyden's field notes (but was not typed in the records) as a 6" White Oak, scribed "CS-BT" which bears $S70\frac{3}{4}^{\circ}E$, 32.4 feet.

August 12, 1971
Gary Kaiser, Deputy County Surveyor
Lloyd Shreeve


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

GCDB 300700

Section corner common to Sections 32 and 33, Township 34 South, Range 2 West and Sections 4 and 5, Township 35 South, Range 2 West, W.M.

Found projecting 3 ins., the 1 ins. diam. galvanized iron pipe, with 2½ ins. diam. brass cap marked:

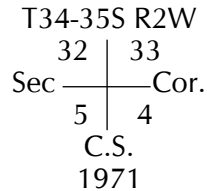

As recorded on Second Re-establishment in 1971.

Bearing trees marked on first re-establishment in 1944 and reported in 1971, found and measured to center of tree(s) at lower blaze:

- White Oak, 19 ins. diam. with healed blazes, brs. Record: N58½°E, 69.8 feet.
- White Oak, 10 ins. diam. with scribe marks visible in partly exposed upper face, brs. Record: S71°E, 32.4 feet. **Note:** distance to upper face is 32.4 feet also.
- White Oak, 12 ins. diam. with healed blazes, brs. record S10½°W, 31.6 feet.
- White Oak, 25 ins. diam., with healed blazes, brs. N3¼°W, 60.6 feet. Record: 60.3 feet.

Mk a new tree:

- White Oak, 6 ins. diam., scribed "CS" "BT", brs. N2°W, 22.25 feet to center of tree at lower blaze.

Corner lies 6 feet west of page wire fence, c. North-South, 33 feet North of draw, c. ESE and 180 feet South of ridge top c. East.

January 12, 1989
R. Frost, Tech.
S. Beecher, Tech.

Verlyn Thomas
County Surveyor

V = 18°

P. -17