

GCDB 340140

Center quarter corner to Section 33, Township 35 South, Range 2 West, W.M.

SEE RECORDED SURVEY NO. 2915


SEE NEXT PAGE FOR FIRST RE-ESTABLISHMENT

FIRST RE-ESTABLISHMENT

GCDB 340140

Center quarter corner to Section 33, Township 35 South, Range 2 West, W.M.

At corner location found a 2 ins. diameter metal disc in a 8 ins. diameter rough concrete base per recorded survey no. 2915, 12 ins. deep, replaced monument with a 2 ½ ins. brass disc in concrete flush with ground surface directly over found monument, brass disc marked:

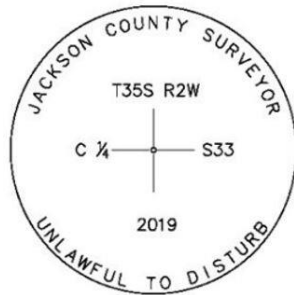

Set new references, 5/8 x 24 ins. rebar with 2 ins. diameter aluminum caps marked "Jackson County Surveyor":

- Flush in southwest corner of Dixie Road cul-de-sac, 7 feet east of north-south bearing fence, 6 feet north of east-west bearing fence, bears N88°03'09"W, 82.65 feet.
- Flush on east side of said cul-de-sac, 50 feet north of east-west bearing fence, 3 feet west of end of east-west bearing plastic fence, bears N03°35'51"W, 50.31 feet.
- 2 ins. deep, 50 feet east of power pole, 2 feet north of east-west bearing fence, 15 feet south of centerline of gravel driveway, bears S88°43'38"E, 55.06 feet.

The First Re-establishment, dated 2019, brass capped north quarter corner to said Section 33, bears N0°48'42"W, 2637.71 feet. Record: N0°34'50"W, 2637.93 feet (per said survey no. 2915).

The First Re-establishment, dated 2019, brass capped east quarter corner to said Section 33, bears N89°58'38"E, 2650.54 feet.

The First Re-establishment, dated 1979, brass capped south quarter corner to said Section 33, bears S0°48'35"E, 2638.19 feet. Record: S0°34'50"E, 2637.92 feet (per said survey no. 2915).

Corner is located at the end of Dixie Road cul-de-sac, 3 feet southwest of power pole no. 1335002-335501.

Basis of Bearing: NAD83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-00015

August 29, 2019
O. Ribanszky
J. Hall

Scott Fein
County Surveyor