


FIRST RE-ESTABLISHMENT

GCDB 400540

Quarter corner common to Sections 9 and 10, Township 36 South, Range 1 East.

Found a $\frac{5}{8}$ " iron pin in a mound of stone for corner. Removed said pin and at the exact location of same, set a 1" x 36" galvanized iron pipe, 30" in the ground with a $2\frac{1}{2}$ " bronze cap stamped:

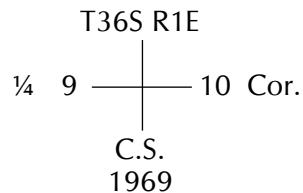

From which:

- The original bearing tree, now an 18" White Oak scribed "1/4 S" bears $S84^{\circ}W$, 123.3 feet to the face of the upper blaze. (record = $S85^{\circ}W$, 124.1 feet)
- The original bearing tree, now a 14" White Oak, the upper face has been chopped out, the lower blaze left intact bears $N60^{\circ}E$, 42.3 feet to the face of the upper blaze.
- A 9" White Oak scribed "CS-BT" bears $S29\frac{1}{2}^{\circ}E$, 152.4 feet to the face of the lower blaze.
- A 14" White Oak scribed "CS-BT" bears $N55\frac{1}{2}^{\circ}W$, 109.0 feet to the face of the upper blaze.

February 10, 1969
F. Roberts, Deputy County Surveyor
Gary Kaiser