


FIRST RE-ESTABLISHMENT

GCDB 700240

Quarter corner common to Section 25, Township 36 South, Range 1 East, and Section 30, Township 36 South, Range 2 East, W.M.

From evidence described below, at a proportionate distance on line between the Section corners to the North and South, set a 1x36 ins. galvanized iron pipe 2 ins. deep. In the top of said pipe, set in concrete, a 2½ ins. diam. brass cap marked:

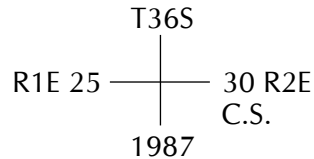

Original bearing tree marked by Ives and Hyde in 1854 found:

- Pine, a 5 feet long, 12 ins. diam. piece with scribed ¼ S visible, brs. S57°W, 40.1 feet to said face. Record; S43°W, 54.78 feet. **Note:** This is the same piece of pine mentioned on corner report No. 37.
- The "possible stump hole", noted on said report, could not be found. The area is pasture, and all traces of holes have been obliterated.
- The section of Pine has most probably been moved about by cattle, however, its location and markings remain original evidence.

See Job File 87-62 for section line diagram and notes.

Scribe new trees "CS" "BT" and measure to center of tree at lower blaze:

- White Oak, 10 ins. diam., brs. S31¾°W, 40.01 feet.
- White Oak, 7 ins. diam., brs. N39°W, 52.87 feet.

No tree available in Section 30. The apparent top of a small spur brs. South, 1573 feet. Record; 1584 feet. The peak of Mt. McLaughlin brs. N84°E.

Corner lies 6.0 feet East of a wandering north-south fence in a pasture.

November 5, 1987
D. Edwards, Tech.
T. Newcomb, Tech.

Edward McGinty
County Surveyor

V = 18½°

P. -407