

FIRST RE-ESTABLISHMENT

GCDB 500200

Section corner common to Sections 26, 27, 34 and 35, Township 36 South, Range 3 East, W.M.
V = 20°

Found the original stone set by R. Moore in 1883, now broken lying alongside a found 5/8 ins. diam. re-steel rod projecting 12 ins. with an aluminum cap marked:

MEDCO	
27	26

34	35

The stone, though broken, was pieced together and measured 18 x 10 x 10 ins. with 2 definite notches on one side. A small portion of the stone that would have been marked with 1 notch was missing. The pin as set by Medco was found in a depression left by the stone.

- No evidence of the original BTs was found, however, this position was further substantiated by a 1933 USFS corner report by W. A. Grim which called for the stone in place and one dead and down BT with proportionate location which fit reasonably.

I set a 1 x 36 ins. G.I. pipe 27 ins. in the ground over the found 5/8 ins. I. pin with a 2 1/2 ins. bronze disc marked:

JACKSON COUNTY	
T36S R3E	
27	26

34	35
1975	

I place the stone alongside, mound stones around corner, marked new trees C.S. BT and take measurements to center of tree at lower blaze:

- Incense Cedar, 31 ins. diam., bears N32 1/2°E, 10.5 feet.
- Douglas Fir, 20 ins. diam., bears S6°E, 79.6 feet.
- Incense Cedar, 9 ins. diam., bears S43°W, 32.6 feet.
- W. Fir, 7 ins. diam., bears N23 1/2°W, 73.5 feet.
- Douglas Fir, 9 ins. diam., bears N48°W, 29.5 feet. (**Note:** This tree may be removed as it is inside a flagged road right-of-way)
- Old blazed lines run North, South, East and West from corner.

September 30, 1975
K. Weaver
H. Center (USFS)


Approved by: Edward McGinty
County Surveyor

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT
GCDB 500200

Section corner common to Sections 26, 27, 34, and 35 of Township 36 South, Range 3 East, W.M.

Found at the corner position, exposed 4 ins., in a mound of stones, the 1 in. diam. galv. iron pipe with a 2½ ins. diam. brass cap set on 1st re-establishment in 1975 and marked:

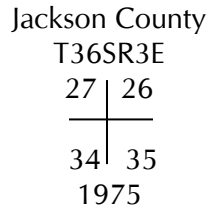

Bearing trees recorded on said 1st re-establishment found with healed double blazes and measured to center at lower blaze;

- Cedar high stump with a partially healed double blaze with scribe 'CS''BT' brs. record ; N32½°E, 10.5 ft.
- D. fir stob brs. record ; S6°E, 79.6 ft.
- Cedar now 13 ins. dia. brs. record ; S43°W, 32.6 ft.
- W. fir now 14 ins. diam. brs. record ; N23½°W, 73.5 ft.
- D. fir now 14 ins. diam. brs. record ; N48°W, 29.5 ft.

Marked new bearing trees 'CS''BT' and measured to center at lower blaze;

- D. fir 24 ins. diam. brs. S55½°E, 26.4 ft.
- No trees within limits in North-East quadrant.

Corner lies approx. 50 ft. south-easterly of intersection of dirt and gravel roads.

November 5, 2009

B. Beeman

Kerry K. Bradshaw
Jackson County Surveyor

P. -262
V. - 13°