

FIRST RE-ESTABLISHMENT

GCDB 600100

Section corner on Township line, Sections 35, and 36, Township 36 South, Range 4 West, and Sections 2 and 1, Township 37 South, Range 4 West.

Found original bearing trees to Northwest, Southwest and Southeast with scribes visible, from which set a spike in top of 6" White Oak stump for corner,

From which:

- The original BT a 30" White Oak, bears North $42\frac{1}{4}^{\circ}$ West, 58.8 feet.
- Scribed a 6" White Oak CS-BT which bears North 36° East, 40.0 feet;
- The original BT a 10" White Oak bears South 8° East, 18.6 feet.
- The original BT a 16" White Oak bears South $54\frac{1}{2}^{\circ}$ West, 49.0 feet.

December 16, 1943

C. Z Boyden

J. H. Cushman

Lee Davis

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT


SECOND RE-ESTABLISHMENT

GCDB 600100

Section corner common to Sections 35 and 36, Township 36 South, Range 4 West and Sections 1 and 2, Township 37 South, Range 4 West, W.M.

Found Oak stump with nail in top rotted out set for corner on first re-establishment by Deputy County Surveyor, C. Z. Boyden on December 16, 1943.

Set a 1"x36" galvanized iron pipe 33" in ground in stump hole with 2½" bronze cap stamped:

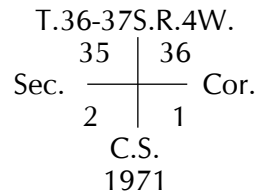

From which:

- The original bearing tree to Northwest, now a 32" White Oak in fair condition with rotted out faces bears N42¼°W, 58.8 feet to the face of the upper blaze (original Record: 20" White Oak N43°W, 58.1 feet; 1943 Record: 30" White Oak, N42¼°W, 58.8 feet);
- The original bearing tree to the Southwest, now a 17" White Oak with the upper blaze open and rotted, bears S54½°W, 49.0 feet to face of the upper blaze (original Record: 12" White Oak, S55°W, 74 lks; 1943 Record: 16" White Oak, S54½°W, 49.0 feet);
- The original bearing tree to the Southeast, now an 11" White Oak snag with both faces open and scribe visible, bears S8°E, 18.6 feet to face of the upper blaze (original Record: 8" White Oak, S7°E, 28 lks.; 1943 Record: 10" White Oak, S8°E, 18.6 feet);
- The tree marked by Surveyor C. Z. Boyden in 1943, now an 8" White Oak in good condition with healed faces, bears N36°E, 40.25 feet to center of tree (1943 Record: 6" White Oak, N36°E, 40.0 feet);
- A ½" re-bar exposed 5" bears N38¾°W, 1.36 feet. Marked the following new tree:
- A 7" Fir, scribed "CS-BT", bears S65°E, 17.4 feet to face of the lower blaze.

March 5, 1971
Gary Kaiser, Deputy County Surveyor
Otis Blankenship


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

GCDB 600100

Section corner common to Sections 35 and 36, Township 36 South, Range 4 West, W.M. and Sections 1 and 2, Township 37 South, Range 4 West, W.M. $V = 17\frac{1}{4}^\circ$

Found at the corner projecting 6 inches, the 1-inch diameter G.I. pipe with 2½-inch diameter brass cap marked:

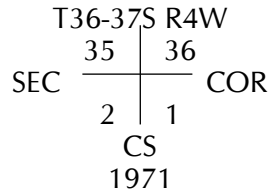

As recorded on Second Re-establishment, in 1971, T36S, R4W.

References recorded on second re-establishment found:

- The base and root hole of a down Fir, 9 ins. diam. brs. S55°E, 17.4 feet. Record: S65°E, 17.4 feet.
- Rebar, ½ ins. diam., found flush with the ground, brs. Record: N38¾°W, 1.36 feet.

Original bearing trees marked by Ives and Hyde in 1854 and noted in 1971 found:

- The center of the stump of a down White Oak, 11 ins. diam., with rotted out faces, brs. S8°E, 18.86 feet. Record: S8°E, 18.6 feet.
- White oak, 18 ins. diam. with rotted upper face, brs. S54½°W, 48.76 feet to center of tree at healed lower blaze. Record: S54½°W, 49.0 feet.
- White oak, 33 ins. diam., with rotted faces, brs. record (1971); N42¼°W, 58.8 feet to estimated upper face.

The bearing tree marked in 1943, first re-establishment, T36S, R4W, and noted in 1971 I find as follows:

- White Oak, now 9 ins. diam. with healed blazes, brs. (1971 record); N36°E, 40.25 feet to center of tree at lower blaze.

I mark new trees "CS" "BT" and take measurements to center of trees at lower blaze:

- White Oak 9 ins. diam. brs. S71°E, 32.66 feet
- White Oak 6 ins. diam. brs. S54½°W, 4.72 feet.
- White Oak 9 ins. diam. brs. N20½°W, 31.13 feet.

Corner lies about 175 feet East of branch, course; Northwesterly and 3 feet South of wood post corner of North and West bearing fence lines.

July 16, 1980

R. Frost
J. Gallegos

Approved by: Edward McGinty
County Surveyor