

FIRST RE-ESTABLISHMENT

GCDB 700400

Section Corner 13 and 24, Township 36 South, Range 4 West, and 18 and 19, Township 36 South, Range 3 West, Willamette Meridian.

Found all four original witness trees in bad shape, fire burned and decayed.

Set laurel stake and blazed a 36" White Oak marked BT which bears North 44° East, 75 feet.

A. T. Brown,
Deputy County Surveyor
C. D. Runyon, Chainman
M. B. Kellogg, Chainman.

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

GCDB 700400

Section corner common to Sections 18 and 19, Township 36 South, Range 3 West, and Sections 13 and 24, Township 36 South, Range 4 West, W.M. $V = 19^\circ$

Found, in mound of stone, mining rail (maximum dimensions $2\frac{1}{2} \times 2\frac{1}{2}$ ins.) projecting 33 ins. center punched on top and stamped "J.R.W. 1306" (John R. White, Registered Engineer No. 1306) see survey No. 3711, dated 1968.

Original BTs recorded by Ives and Hyde in 1854, found as follows:

- Rotted White Oak stump remains, bears record $N28^\circ$, 29.04 feet.
- A Black Oak snag, 17 ins. diam., with evidence of old axe work, bears $S42^\circ E$, 46.15 feet to center of tree. Record: $S42^\circ E$, 44.88 feet.
- A stump hole found at record location of original S.W.BT
- A BT recorded by A.T. Brown on first re-establishment (page 1, apparently in 1914) a White Oak, now 36 ins. diam., containing scribed "BT" in exposed lower face, bears record $N44^\circ E$, 75.0 feet to scribed face.

I marked the following trees CS BT and take measurements to center of trees at lower blaze:

- A Ponderosa Pine, 8 ins. diam., bears $N49^\circ E$, 45.50 feet.
- A White Oak, 7 ins. diam., bears $S72^\circ E$, 37.30 feet.
- A Black Oak, 4 ins. diam., bears $S64^\circ W$, 13.58 feet.
- A Black Oak, 5 ins. diam., bears $N23^\circ W$, 25.57 feet.

Corner lies in small draw, 35 feet West of spring branch C. $S20^\circ E$, and about 55 feet West of wood road.

Old mining ditch bears $N45^\circ W$, 12.0 feet.

March 28, 1975

B. Malotte
R. Frost

Approved by: Edward McGinty
County Surveyor

SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

GCDB 700400

Section corner common to Sections 13 and 24, Township 36 South, Range 4 West, and Sections 18 and 19, Township 36 South, Range 3 West.

At the corner, found projecting 33 ins., the mining rail described on Second re-establishment, page 24, in 1975.

Bearing trees marked on Second re-establishment, now burned by recent fire, found and measurements taken to center of trees at lower blaze:

- Ponderosa Pine, 9 ins. diam., bears N49°E, 45.43 feet. Record: 45.5 feet.
- White Oak, 8 ins. diam., bears S71°45'E, 37.30 feet. Record: S72°E.
- Black Oak, 5 ins. diam., bears S63°30'W, 13.65 feet. Record: S64°W, 13.58 feet.
- Black Oak, 7 ins. diam., bears N23°15'W, 25.51 feet. Record: N23°W, 25.57 feet.

The bearing tree recorded on First re-establishment, page 1,

- A White Oak, now 36 ins. diam., with burned out lower face, bears, Record: N44°E, 75.0 feet to estimated lower face. Re-measured 76.22 feet to center of tree.

As all trees in vicinity of corner have been fire damaged, set $\frac{5}{8}$ x 30 ins. rebars, 26 ins. in the ground, with yellow plastic caps marked "JACKSON C.S.":

- N49°09'E, 44.58 feet.
- S71°40'E, 35.99 feet.
- S63°23'E, 12.55 feet.
- N23°15'W, 24.43 feet.

Corner lies in small draw, c. S80°E, 35 feet West of spring branch c. S20°E, 55 feet West of old road and S45°E, 12 feet from old mining ditch.

October 21, 1981
R. Frost
R. Templin

Edward McGinty
County Surveyor

V-18½°
P. -170

SEE NEXT PAGE FOR FOURTH RE-ESTABLISHMENT


FOURTH RE-ESTABLISHMENT

GCDB 700400

Section corner common to Sections 13 and 24, Township 36 South, Range 4 West, and Sections 18 and 19, Township 36 South, Range 3 West, W.M.

Found approximately 25 feet southerly of the hole from which it was removed, the mining rail corner monument described on third re-establishment, in 1981.

Replace said rail with and deposit it alongside a 1x36 ins. galvanized iron pipe set 32 ins. in the ground, with a 2½ ins. diam. brass cap marked:

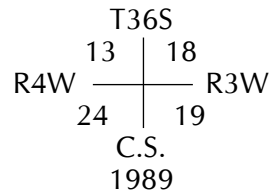

Bearing trees reported fire damaged in 1981, found as follows:

- A burnt pine snag with healed blazes, brs. N48¾°E, 45.5 feet to center of tree at lower blaze. Record: N49°09'E, 44.58 feet.
- The center of an oak stump, sawed flush, brs. S72°E, 37.3 feet. Record: S71°45'E.
- The center of broken-off oak stump, brs. S61¾°W, 13.6 feet. Record: S64°W, 13.58 feet.
- The center of (oak) stump hole brs. N24¾°W, 25.6 feet. Record: N23°15'W, 25.51 feet.

References set in 1981; 5/8 ins. diam. rebars with yellow plastic caps marked "Jackson C.S." found flush. All, with exception of the Northeast, appear to have been disturbed by logging activity.

- N48¾°E, 44.58 feet. Record: N49°09'E, 44.58 feet.
- S72°E, 36.45 feet. Record: S71°40'E, 35.99 feet.
- S61¾°W, 12.41 feet. Record: S63°23'E, 12.55 feet (erroneous quadrant noted in 1981).
- N24¾°W, 25.06 feet. Record: N23°15'W, 24.43 feet.

For corner location see third re-establishment.

May 4, 1989
T. Newcomb, Tech.
H. Durkee, Tech.

Verlyn Thomas
County Surveyor

V = 17¼°

P. -132