


FIRST RE-ESTABLISHMENT

GCDB 700600

Section corner common to Sections 6 and 7, Township 36 South, Range 3 West and Sections 1 and 12, Township 36 South, Range 4 West, W.M.

Found projecting 2 ins., unrecorded 2 ins. diam. iron pipe 18 ins. long, with a broken unmarked stone on west side of pipe. Replaced pipe with a 1 x 36 ins. galvanized iron pipe set 30 ins. in the ground with a 2½ ins. diam. brass cap marked:

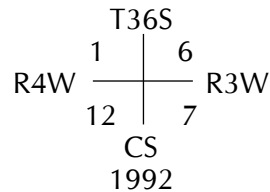

Original bearing trees recorded by Ives and Hyde in 1854 found:

- Stump hole with remains of a burned Pine, bears record N10°W, 20.46 feet to estimated face.
- **Note:** On March 27, 1992, we found a Pine snag 33 ins. diam., with a portion of the tree laying nearby containing scribe marks "T36" on axed and burned faces. This is now gone due to the recent fire.
- At or near the position of the SW bearing tree found burned faces containing scribe marks "BT". Upper face too burned to read. No visible stump hole.

Found a 5/8 ins. rebar projecting 6 ins., bears N65°E, 49.30 feet set on Survey No. 5786, dated 1974.

Set 5/8 x 24 ins. rebar with aluminum cap marked: "Jackson County CS" projecting 6 ins.:

- Brs. N39°E, 7.28 feet.
- Brs. S64°E, 10.40 feet with 5½ feet fence post and attached location tag set behind rebar.
- Brs. S4½°W, 6.62 feet with 5½ feet fence post and attached location tag set behind rebar.
- Brs. N37½°W, 14.15 feet.

Found old blazing South of corner that dates back 85 to 90 years.

Corner lies on South slope about 130 feet North of draw course SW.

October 7, 1992
T. Newcomb, Tech.
J. Burgess

Verlyn Thomas
County Surveyor

V = 19½°
P. -106