

## FIRST RE-ESTABLISHMENT

GCDB 300700

Section Corner on the Township line Sections 32 and 33, Township 37 South, Range 1 West, and Sections 4 and 5, Township 38 South, Range 1 West, W.M.

Found a  $\frac{3}{4}$ " iron pin for corner, also the remains of all four original BTs.

Set a 2" x 26" galvanized iron pipe 2" below the surface of the ground for corner at the exact location of the said iron pin.

From which:

- 20" White Oak scribed CS-BT bears N5°W, 82.3 feet.
- Scribe a 12" White Oak CS-BT which bears N30°E, 46.7 feet
- Scribe an 8" White Oak CS-BT which bears S74 $\frac{1}{4}$ °E, 25.0 feet.
- Scribe an 8" White Oak CS-BT which bears S35 $\frac{3}{4}$ °W, 80.2 feet.

January 18, 1954

C. Z. Boyden

L.C. Pinkham

M. E. Boyden

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

## SECOND RE-ESTABLISHMENT

GCDB 300700

Section corner common to Sections 32 and 33, Township 37 South, Range 1 West, and Sections 4 and 5, Township 38 South, Range 1 West, W.M.  $V = 19\frac{3}{4}^\circ$

Found, 6 inches below the surface of the ground, the 2-inch diameter G.I. pipe, set for the corner of First re-establishment, page 30, in 1954.

In the top of found pipe, in cement, I set a 3-inch diameter brass cap marked:

T37S	R1W	
32	33	
5	4	CS
T38S		
1980		

Bearing trees recorded on First re-establishment found as follows:

- White Oak, 16-inch diameter with healed blazes, bears Record:  $N30^\circ E$ , 46.7 feet to estimated face. Re-measured 47.11 feet to center of tree at lower blaze.
- White Oak, 12-inch diameter, with healed blazes, bears  $S74^\circ 10' E$ , 25.33 feet to center of tree at lower blaze. Record:  $S74\frac{1}{4}^\circ E$ , 25.0 feet.
- White Oak, 12-inch diameter, with healed blazes, bears  $S36^\circ W$ , 80.47 feet to center of tree at lower blaze. Record:  $S35\frac{3}{4}^\circ W$ , 80.2 feet.
- White Oak, 24-inch diameter, with healed blazes, bears Record:  $N5^\circ W$ , 82.3 feet to estimated face. Re-measured 83.22 feet to center of tree at lower blaze.

I set  $\frac{5}{8}$  x 30-inch rebars flush with the surface of the ground, with yellow plastic caps marked: "Jackson C.S." as follows:

- $N53^\circ 13' E$ , 26.59 feet.
- $S50^\circ 13' E$ , 12.00 feet.

March 19, 1980  
D. Danielsen  
R. Frost

Approved by: Edward McGinty  
County Surveyor


**SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT**

**THIRD RE-ESTABLISHMENT**

**GCDB 300700**

Section corner common to Sections 4 and 5, Township 38 South, Range 1 West and Sections 32 and 33, Township 37 South, Range 1 West, W.M.

Found 6 inches deep, the 2-inch diameter iron pipe, with 3-inch diameter brass cap marked:

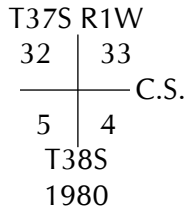

As recorded on Second Re-establishment, page 87, dated 1980.

Bearing trees reported in 1980 found and measured to center of trees at lower blaze:

- White Oak, 18-inch diameter, with healed blazes, bears Record: N30°E, 47.11 feet.
- White Oak, 13-inch diameter, with healed blazes, bears Record: S74°10'E, 25.33 feet.
- White Oak, 13-inch diameter, with healed blazes, bears Record: S36°W, 80.47 feet.
- White Oak, 26-inch diameter, with healed blazes, bears Record: N5°W, 83.22 feet.

As the Northeast bearing tree is being removed and the (2) rebar references, set in 1980, have been disturbed (bent over) during current (house) construction, take new references:

- 5/8 x 24-inch rebars set 2 inches deep, with yellow plastic caps marked "Jackson C.S.", bear:
  - ▶ S36°W, 18.79 feet.
  - ▶ S36°W, 64.53 feet.

August 11, 1987  
R. Frost, Tech III  
S. Beecher, Tech I

Edward McGinty  
County Surveyor

P. -291