

FIRST RE-ESTABLISHMENT

GCDB 700240

Quarter corner common to sections 25 and 30, Township 38 South Range 1 West, Range 1 East W.M.

The corner was originally set in 1854 under GLO contract to Ives and Hyde and consisted of a post and mound with pits.


No evidence of the original corner monument was found.

On a single proportionate measurement between section corners north and south, established during the course of survey 4457 and perpetuated by the office of the Jackson County Surveyor a 1 ins. by 36 ins. GIP, with 2½ ins. brass cap was set at position. MKD:

T38S
¼
R1W | R1E
S25 | S30
2008

From which the following references were set:

- 5/8-ins. by 24 ins. rebar with a 1½ ins. diam. aluminum cap brs. S86°06'07"W, 41.61ft. Set flush, lies approx. 26 ft. W. of asphalt.
- 5/8-ins. by 24 ins. rebar with a 1½ ins. diam. aluminum cap brs. S8°55'29"E, 34.47ft. Set flush, lies approx. 26 ft. W. of asphalt.

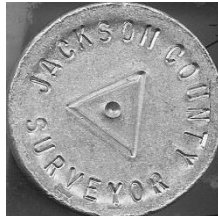

- Mag nail and washer set flush on W. edge asphalt brs. N55°11'08"W, 120.36 ft.
- Mag nail and washer set flush on W. edge asphalt brs. S56°28'05"E, 89.59 ft.

Corner lies approx. ¾ miles south of the Talent overpass on the west edge of the asphalt of the southbound lane of I-5. Place sign on fence post of a N-S fence.

Search Coordinate only, NAD 83: N 215800.4, E 4309934.1

June 11, 2008
S. Fein
S. Beecher

Roger Roberts
County Surveyor

Job File: 2008-06
P. -11,
Series II, Book I