

SPECIAL CORNER

FIRST RE-ESTABLISHMENT


GCDB 700440

Quarter corner common to Section 13, Township 38 South, Range 1 West, and Section 18, Township 38 South, Range 1 East, W.M.

Found 1 inch deep, at the corner post to fences bearing North, South and West, an 18x8x8-inch sandstone with a small portion of the top broken off.

Replaced said stone with and deposit it alongside of, a 1x36-inch Galvanized iron pipe set 28 inches in the ground.

In the top of said pipe, set a 2½-inch diameter brass cap marked:

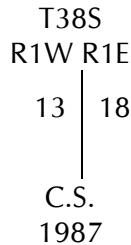

Take references as follows:

- A 5/8 x 24 inches rebar with yellow plastic cap marked "Jackson CS", set flush in an East-West fence, bears S89°38'54"W, 49.06 feet.
- White oak, 22-inch diameter, scribed "CS BT", bears N86°53'W, 55.70 feet to center of tree at lower blaze.
- A 5/8 x 24 inches rebar with yellow plastic cap marked "Jackson CS", set flush in a North-South fence, bears N2°02'25"W, 47.72 feet.
- A 12-inch diameter, very old corner post to fences bearing North, South and West. The remaining portion of which is suspended 0.5 feet in the air by the fence wire, bears S60°W, 0.7 feet.
- The Southeast corner of Section 13, bears S0°01'09"E, 2650.11 feet. Record per First re-establishment, page 1 in 1923, of said Southeast corner; South 2650 feet.
- The brass cap at the Northeast corner of Section 13, bears N0°00'06"W, 2659.12 feet. GLO Record: North 2640 feet.

The corner lies at the Southeast corner of a pasture, 3.0 feet South of an 8-inch diameter irrigation pipe, and being surrounded on the East and South by blackberries.

Note: See Jackson County Job File 86-70 for further information.

February 26, 1987
D. Edwards
R. Frost

Edward McGinty
County Surveyor

P. -47