

## FIRST RE-ESTABLISHMENT

DLC50WSW

GCDB 847100

Re-establishment of the Northerly Northwest corner of DLC #47, Township 38 South, Range 1 West, W.M. (Also being the WSW corner of DLC #50)

Found 4" brass capped monument 12" below the surface of the road corner, the recognized corner for over 35 years (no evidence of the original corner).

Also found:

- A 4" brass capped monument which bears  $N\frac{1}{2}^{\circ}E$ , 30.38 feet.
- The center of a 20" apple tree bears  $N29\frac{3}{4}^{\circ}E$ , 65.7 feet.
- The center of a 7" pear tree bears  $S19^{\circ}W$ , 48.8 feet.
- Set a  $\frac{3}{4}$ " x 30" iron pin which bears  $S45^{\circ}E$ , 44.0 feet.

September 3, 1947

C. Z. Boyden

L. D. Pinkham

G. L. Ray

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

## SECOND RE-ESTABLISHMENT

DLC50WSW

GCDB 847100

North Northwest corner of DLC #47, Township 38 South, Range 1 West, W.M. (Also being the WSW DLC #50.)

Found a 4" brass cap 17" below the surface of the county road as reported for the corner of the First Re-establishment on September 3, 1947.

Replaced said brass cap with a 20" diameter by 14" deep concrete monument with a 3" bronze cap 8" deep in a monument case, stamped:

JACKSON COUNTY  
T38S R1W  
NW DLC  
Cor. 47  
1970  
CONTROL MONUMENT

From which:

- A 30" Pear tree bears N29 $\frac{3}{4}$ ° E, 65.7 feet to the center. (1947 Record: 20" Apple tree, N29 $\frac{3}{4}$ °E, 65.7 feet to center);
- A 16" Pear tree bears S18 $\frac{1}{2}$ °W, 48.9 feet to the center. (1947 Record: 7" Pear tree, S19°W, 48.8 feet to center);
- Found a 7/8" threaded iron rod, 3" deep, which bears S45 $\frac{1}{4}$ °E, 44.24 feet. (1947 Record:  $\frac{3}{4}$ " iron pin, S45°E, 44.0 feet)

Set a new bearing object as follows:

- Set a lead plug with tack in the Southwest corner of a concrete irrigation box which bears N21 $\frac{3}{4}$ °W, 33.34 feet.

March 29, 1972  
Lloyd Shreeve  
Ray Webber

Approved by: Mark E. Boyden  
County Surveyor

SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

**THIRD RE-ESTABLISHMENT**

**DLC50WSW**

**GCDB 847100**

Northerly Northwest corner to DLC No. 47, Township 38 South, Range 1 West, W.M. (Also being the SW cor. DLC #50)

Found 7 inches deep in monument case, in middle of South Stage Road, the brass cap reported on Second Re-establishment in 1972.

Directly over said brass cap, set in concrete, a 2½-inch diameter brass cap marked:

T38S R1W

DLC

NW  
47

C.S.

1984

Flush with road surface.

References recorded on Second Re-establishment found:

- Threaded bolt, 7/8-inch diameter, found 6 inches deep, bears S44°56'E, 44.27 feet. Record: S45¼°E, 44.24 feet.
- Pear tree, 16-inch diameter bears S18°49'W, 48.82 feet to center of tree at base. Record: S18½°W, 48.9 feet.
- Tack in lead plug in the Southwest corner of a 4 x 5 feet concrete irrigation box bears N21°22'W, 33.32 feet. Record: N21¾°W, 33.34 feet.
- A found ½-inch diameter iron pin (flush) bears S39°17'E, 44.13 feet.
- A found 4-inch diameter brass cap (flush) bears N0°37'E, 30.54 feet.

Set a new reference:

- Railroad spike, flush in North shoulder of road, bears N29°E, 18.54 feet.

February 7, 1984

E. McGinty

R. Frost

B. Smith

Edward McGinty

County Surveyor

P. 10-11

**SEE NEXT PAGE FOR FOURTH RE-ESTABLISHMENT**

FOURTH RE-ESTABLISHMENT  
DLC50WSW  
GCDB 847100

SPECIAL CORNER

North Northwest Corner of Donation Land Claim No. 47 identical with the Southwest Corner of Donation Land Claim No. 50, located in Section 6, Township 38 South, Range 1 West, W.M.

Found an unrecorded Jackson County 2½-inch diameter brass cap marked:

T38S R1W

NW
DLC
47
1994

Flush with the road surface.

References reported on the Third Re-establishment, dated 1984 found;

- Lead and tack in the Southwest corner of a 4-foot x 5-foot concrete irrigation box, bears N21°27'33"W, 33.34 feet. Record: N21°22'W, 33.32 feet.
- A 4-inch diameter brass cap 16 inches deep marked: 'CHICK • RED', bears N0°33'38"E, 30.54 feet. Record: N0°37'E.

New references:

- Found .38 caliber shell set in asphalt near fog line of West bound lane, bears N62°06'37"E, 25.64 feet.
- Set 5/8-inch diameter rebar with aluminum cap marked 'JACKSON COUNTY SURVEYOR' flush with ground, bears S30°25'23"E, 56.86 feet and located 1.20 feet West of a 2-inch diameter iron gate post and last post South.

May 5, 2000  
T. Newcomb  
J. Burgess

P. -19

SEE NEXT PAGE FOR FIFTH RE-ESTABLISHMENT


## FIFTH RE-ESTABLISHMENT

DLC50WSW

GCDB 847100

North Northwest Corner of Donation Land Claim No. 47 identical with the Southwest Corner of Donation Land Claim No. 50, located in Section 6, Township 38 South, Range 1 West, W.M.

Found, per Fourth Re-establishment, dated 2000, the unrecorded Jackson County 2½-inch diameter brass cap marked:

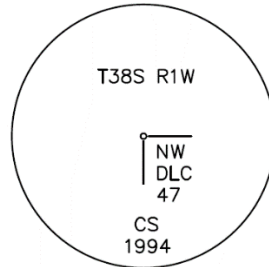

References per Fourth Re-establishment found as follows:

- Flush, a tack in lead in the southwest corner of a 4-foot x 5-foot concrete irrigation box, bears  $N21^{\circ}47'24''W$ , 33.34 feet. Record:  $N21^{\circ}27'33''W$ .
- 12 ins. deep, the 4 ins. diameter brass cap marked "CHICK RED" with center punch, leaning slightly northerly, bears  $N0^{\circ}10'39''E$ , 30.62 feet. Record:  $N0^{\circ}33'38''E$ , 30.54 feet.
- Flush in asphalt roadway surface, a .38 caliber shell casing near fog line of west bound lane, bears  $N61^{\circ}46'09''E$ , 25.64 feet. Record:  $N62^{\circ}06'37''E$ .
- 2 ins. deep, a 5/8 in. diameter rebar with aluminum cap marked "Jackson County Surveyor", bears  $S30^{\circ}47'16''E$ , 56.86 feet. Record:  $S30^{\circ}25'23''E$ .

Set new reference, 5/8 x 24 ins. rebar with 2 ins. diameter aluminum cap marked "Jackson County Surveyor":

- 2 ins. deep in south gravel shoulder of South Stage Road, 2 feet south of asphalt edge and approximately 75 feet west of centerline of pear orchard gravel access road, bears  $S63^{\circ}46'41''W$ , 63.06 feet.

Corner is located in west bound lane of South Stage Road approximately 1 in. deep in asphalt roadway surface.

Basis of Bearing: NAD83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-00015

February 8, 2021  
O. Ribanszky  
J. Hall

Scott Fein  
County Surveyor