

## FIRST RE-ESTABLISHMENT

GCDB 400400

Section corner common to Sections 15, 16, 21 and 22, Township 39 South, Range 3 East, W.M.

Set a 1" x 36" galvanized iron pipe 30" in the ground with a 2½" bronze cap stamped:

|      |          |      |
|------|----------|------|
|      | T39S R3E |      |
|      | 16   15  |      |
| Sec. | —+—      | Cor. |
|      | 21   22  |      |
|      | C.S.     |      |
|      | 1967     |      |

From which:

- A 26" Fir stump with BT scribe bears N54°E, 9.2 feet to the face of the blaze.
- A 30" Fir stump with BT scribe bears S63½°E, 11.9 feet to the face of the blaze.
- A 16" Fir plainly scribed bears S45½°W, 25.9 feet to the face of the upper blaze.
- A 28" Fir plainly scribed bears N64°W, 17.2 feet to the face of the upper blaze.

Marked the following new trees:

- A 20" lodge pole pine scribed CS-BT bears N8½°E, 85.8 feet to the face of the upper blaze.
- A 20" Fir scribed CS-BT bears S88½°E, 89.0 feet to the face of the upper blaze.

October 19, 1967  
L. D. Pinkham,  
Deputy County Surveyor

Gary Kaiser

**SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT**

## SECOND RE-ESTABLISHMENT

GCDB 400400

Section corner common to Sections 15, 16, 21 and 22, Township 39 South, Range 3 East, W.M.

Found a spike and shiner in pavement for corner. At the same location set a 1" x 36" galvanized iron pipe, with 2½" bronze cap 0.04 feet below pavement surface, stamped:

|      |      |     |      |
|------|------|-----|------|
|      | T39S | R3E |      |
|      | 16   | 15  |      |
| Sec. |      |     | Cor. |
|      | 21   | 22  |      |
|      | C.S. |     |      |
|      | 1971 |     |      |

From which:

- The bearing tree marked on the First re-establishment by Deputy County Surveyor, L. D. Pinkham on October 19, 1967 (now a 21" Lodge Pole Pine with scribe) bears N8½°E, 85.9 feet to the upper blaze.
- The bearing tree marked on said First Re-establishment (now an 18" White Fir with scribe) bears S88¼°E, 89.0 feet to the upper blaze.

Marked the following new trees:

- A 22" White Fir, scribed "CS-BT" bears S33°W, 105.0 feet to face of the lower blaze.
- A 13" White Fir scribed "CS-BT" bears N74¼°W, 44.9 feet to face of the lower blaze.

August 19, 1971  
Otis Blankenship  
Lloyd Shreeve

Approved by:  
M. E. Boyden,  
County Surveyor


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

### THIRD RE-ESTABLISHMENT

#### GCDB 400400

Section corner common to Sections 15, 16, 21 and 22, Township 39 South, Range 3 East, W.M.

Found 2½" bronze cap set on Second Re-establishment, dated 1971 flush with pavement surface and stamped: T39S R3E The "6" in "16" has been scraped off.

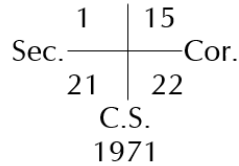

From which;

Bearing trees from the First Re-Establishment, dated 1967, and recorded in 1971, found:

- Lodgepole Pine, now a rotted snag with partially healed double blaze and partial scribing visible was not remeasured.
- White Fir, 37 ins. diameter with healed blazes bears S87°26'22"E, 89.43 ft. to center of tree at base; 1971 record S88¼°E, 89.0 feet to the face of the upper blaze.

Bearing trees marked in 1971, found:

- White Fir, 32 ins. diameter with healed blazes, bears S33°58'43"W, 106.48 ft. to center of tree at base; Record S33°W, 105.0 feet to face of the lower blaze.
- White Fir, 33 ins. diameter bears N73°10'06"W, 45.92 ft. to center of tree at base; Record N74¼°W, 44.9 feet to face of the lower blaze.

New references set:

- Magnail in pavement bears S85°51'19"W, 85.26 ft.
- Magnail in pavement bears S15°51'28"W 40.70 ft.

Corner lies in pavement near the boat ramp at the south end of Hyatt lake.

Basis of Bearing is NAD83 2011 Epoch 2010.00, OCRS GP-ASH Zone per OAR 734-005-0015, as observed from Magnail references noted above.

April 4, 2018  
B.Paull  
T. Kaiser

Scott D. Fein  
Jackson County Surveyour

P.-