

FIRST RE-ESTABLISHMENT
QUARTER CORNER TO SECTION 1 ONLY
GCDB 640700

North quarter corner of Section 1 only, Township 40 South, Range 3 West, W.M. $V = 18\frac{1}{2}^\circ$

Found projecting 12 inches, the 1-inch diameter iron pipe with GLO brass cap marked:

$\frac{1}{4}$

S1
SC

1917 by M. Wright in 1917.

Bearing trees recorded by Wright found as follows:

- Douglas Fir, 19-inch diameter with healed single blaze bears $S39^\circ E$, 19.0 feet to center of tree. Record: $S40\frac{1}{2}^\circ E$, 12.54 feet.
- Ponderosa Pine, 24-inch diameter, scribed "S1 SC BT" in partly healed face bears $S20^\circ W$, 26.14 feet to center of tree. Record: $S19^\circ W$, 25.74 feet.

Note: The above trees are erroneously recorded by Wright as bearing trees to the North $\frac{1}{4}$ of Section 2, T40S, R3W.

I marked a new tree CS BT:

- Douglas Fir, 16-inch diameter bears $N37^\circ W$, 50.80 feet to center of tree at lower blaze.
- The (brass cap) South $\frac{1}{4}$ corner of Section 36 bears East 16.40 feet.

Corner lies on steep NE slope, an estimated 150 feet East of location marker on 36-inch diameter Pine alongside trail C. $S30^\circ E$.

January 19, 1977
B. Malotte
R. Frost


Approved by: Edward McGinty
County Surveyor

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

**SECOND RE-ESTABLISHMENT
QUARTER CORNER TO SECTION 1 ONLY
GCDB 640700**

North quarter corner of section 1 only, Township 40 South, Range 3 West, W.M.

Found exposed 12 ins. the 1 in. diameter iron pipe with 2 ½ ins. diameter standard GLO brass cap, per first re-establishment dated 1977, cap marked:

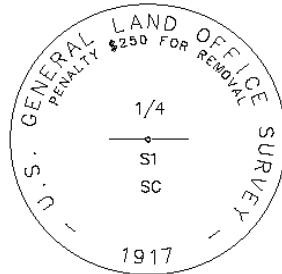

References per first re-establishment found:

- Douglas fir, 24 ins. diameter, with single healed blaze, bears S41°11'12"E, 19.00 feet to center of tree. Record: S39°E.
- 24 ins. diameter sawed-off pine stump, 3 feet high, with visible scribing on partially rotten face, bears S16°32'15"W, 26.14 feet to center of tree. Record: S20°W.
- Douglas fir, 18 ins. diameter, dead, with double healed blazes, bears N36°04'20"W, 50.80 feet to center of tree at lower blaze. Record: N37°W.
- The brass capped south quarter corner of section 36, T39S R3W, W.M., found per second re-establishment dated 2020, bears N89°16'25"E, 16.31 feet. Record: East, 16.40 feet.

Set new references, 5/8 x 24 ins. rebar with 2 ins. diameter aluminum caps marked "Jackson County Surveyor":

- 3 ins. deep, on west edge of north-south bearing gravel road, 21 feet north of 7 ins. diameter madrone, bears S17°16'08"W, 296.48 feet.
- 1 in. deep, bears S64°37'33"W, 45.05 feet.
- 3 ins. deep, on east edge of north-south bearing gravel road, 3 feet west of madrone stump, bears S66°51'35"W, 132.74 feet.

Marked new bearing tree "CS" "BT" and took measurements to center of tree at lower blaze:

- Douglas fir, 14 ins. diameter, bears N89°18'17"W, 9.83 feet.

Corner is located on a heavily timbered steep east facing slope, approximately 130 feet N67°E of location marker posted per this re-establishment on a 6 ins diameter fir on the east edge of a north-south bearing gravel logging road.

Basis of Bearing: NAD83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-00015

April 28, 2020
O. Ribanszky

Scott Fein
County Surveyor