


## FIRST RE-ESTABLISHMENT

### GCDB 100500

Section corner common to Sections 12 and 13, Township 32 South, Range 3 East and Sections 7 and 18, Township 32 South, Range 4 East, W.M.

At the corner, found projecting 4 inches, the 1-inch diameter iron pipe with 2½-inch diameter pot metal filled pipe reducer marked:

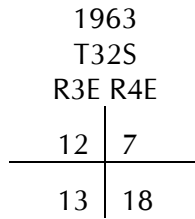

Section Cor.  
RANGES  
583

Set on Survey No. 2165, in 1963.

An original bearing tree recorded by R. Moore in 1884, a Douglas Fir, now 57-inch diameter containing scribe marks including "R3" in partly (re)healed upper face bears S35°W, 13.51 feet to scribed face. Record: 13.86 feet.

Bearing trees marked on above-noted survey found and measurements taken to center of tree at lower blaze:

- White Fir, 11-inch diameter with healed blazes bears N40°E, 16.80 feet. Record: 16.6 feet.
- White Fir, 11-inch diameter with healed blazes, now dead bears S21°E, 18.33 feet. Record: 18.1 feet.
- White Fir, 15-inch diameter, with healed blazes bears N22°15'W, 29.30 feet. Record: N23°W, 28.8 feet.

**Note:** the original stone is found alongside corner as reported on Survey No. 2165.

Marked new trees "CS" "BT" and took measurements to center of trees at lower blaze:

- White Fir, 8-inch diameter bears S36°E, 14.65 feet (4.46 m).
- White Fir, 8-inch diameter bears S59°30'W, 21.55 feet (6.56 m).

Corner lies about 200 feet East of location marker on 10-inch diameter Chinquapin alongside road C. N10°E.

September 14, 1983  
R. Frost  
R. Templin

Edward McGinty  
County Surveyor

V = 19°  
P. -96