

PROPORTIONED CORNER - NO FIRST RE-ESTABLISHMENT

GCDB 400700

Corner to section 3 and 4, township line.

Set iron pin for corner from which

- A 14" yellow pine scribed C.S.-B.T. bears N.40°W., 48.0 feet.
- A 12" yellow pine scribed C.S.-B.T. bears S.41°E., 62.0 feet.
- A 14" black oak scribed C.S.-B.T. bears S.05°W., 68.2 feet.
- An 8" black oak scribed C.S.-B.T. bears N.61°45' E., 77.6 feet.

Feb. 7, 1928

Boyden, Dep. Co. Sur.

Seaman and Kent, Chainmen

The above copied verbatim from Page 4 of the Township 34 South Range 1 West Re-establishment Book. SMB 9/30/2016.

Section corner common to Sections 33 & 34 and 4 & 3, Townships 33 South & 34 South, Range 1 West, W.M. SEE P.4 & 19 34-1W C.S. Re-estab. Book (proportionate corner & re-estab. of proportionate corner).

The above copied verbatim from Page 1 of the Township 34 South Range 1 West section of the Special Corner Book. SMB 9/30/2016.


SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

GCDB 400700

Section corner common to Sections 33 and 34, Township 33 South, Range 1 West and Sections 3 and 4, Township 34 South, Range 1 West.

Found a 3/4 x 24" iron pipe for corner and replaced it with a 1 x 36" galvanized iron pipe with 2 1/2" brass cap set 8" below the surface of the ground and stamped:

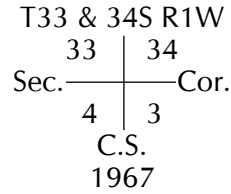

From which:

- A 25" Yellow Pine plainly scribed "C.S." bears South 41 1/2° East, 62.0 feet to the face of the upper blaze;
- A 21" Black Oak plainly scribed "C.S." in upper blaze, bears South 4 1/2° West, 68.2 feet to the face of the upper blaze;
- A 14" Black Oak both blazes intact bears North 61 1/4° East, 77.6 feet to upper face;
- ALL ARE TREES OF THE FIRST RE-ESTABLISHMENT.

The Northeast corner of a concrete porch slab on the East end of the Trail Community Church bears North 87 1/2° West, 75.72 feet.

July 20, 1967
F. A. Roberts
J. Huston

Approved By:
L. D. Pinkham,
Deputy County Surveyor


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

GCDB 400700

Section corner common to Sections 33 and 34, Twp. 33 South, Range 1 West, and Sections 3 and 4, Twp. 34 South, Range 1 West, W.M. $V = 19\frac{1}{4}^\circ$

Found 7 ins. deep, the 1-inch diameter G.I. pipe, with 2½ ins. brass cap marked:

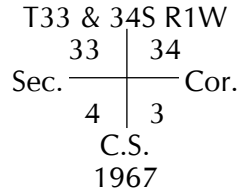

By L. Pinkham on Second Re-establishment (page 19 in 1967).

Bearing trees marked by C. Z. Boyden First Re-establishment (page 4) in 1928 and noted by Pinkham found as follows:

- Black oak, 16-inch diameter, with healed blazes, bears $N61\frac{1}{4}^\circ E$, 77.7 feet to center of tree. Record (1967): $N61\frac{1}{4}^\circ E$, 77.6 feet.
- Sawed yellow pine stump 25-inch diameter with partially exposed face, scribed "CS" bears record (1967): $S41\frac{1}{2}^\circ E$, 62.0 feet to scribed face.
- Black oak, 22-inch diameter bears $S4\frac{1}{2}^\circ W$, 67.48 feet to rotted lower face. Record (1967): $S4\frac{1}{2}^\circ W$, 68.2 feet.
- The NE corner of (church) 3 ins. deep, concrete porch slab, bears record (1967): $N87\frac{1}{2}^\circ W$, 75.72 feet.

I mark a new tree CS BT:

- White oak, 7-inch diameter, bears $S4^\circ 31' E$, 84.11 feet to center of tree at lower blaze.
- The NE corner of parsonage foundation (concrete) bears $N49^\circ 31' W$, 135.71 feet

Corner lies in church parking lot.

July 18, 1978

B. Malotte

R. Frost

Approved by: Edward McGinty
County Surveyor

SEE NEXT PAGE FOR FOURTH RE-ESTABLISHMENT

FOURTH RE-ESTABLISHMENT

GCDB 400700

Proportionate Section Corner common to Sections 33 and 34 Township 33 South Range 1 West, and Sections 3 and 4, Township 34 South, Range 1 West, W.M.

Found the 2½ ins. diam. brass cap set on the Second Re-establishment, dated 1967, 14 ins. deep and marked:

T33&34S1W
33 | 34
— | —
4 | 3
CS
1967

Set a 6 ins. diam. PVC pipe with monument case lid flush with the surface of pavement over the existing monument.

From which bearing trees marked in 1928 found and re-measured on the Third Re-establishment, dated 1978:

- Black Oak 20 ins. diam. with healed double blaze, bears 1978 record N61°25'E, 77.7 ft. to the center of tree at base (most westerly stem of three).
- Black Oak 24 ins. diam. with open and rotted upper and lower faces, bears 1978 record S04°30'W, 67.48 ft. to estimated lower face, re-measure 68.4 ft. to the center of tree at base.

Bearing tree marked in 1978 found:

- White Oak 9 ins. diam. with healed blazes, bears record S04°31'E, 84.11 ft.

The Northeast corner of cement porch slab measured in 1967 and re-measured in 1978 is now broken off. The Northeast corner of parsonage foundation measured in 1978 is not visible.

Set new reference, a 1 in. diam. alloy cap, with center punch and marked "CS", in drilled hole in the Northeast corner of walkway at the front of church, bears N89°16'20"W, 66.14 ft.

Corner is located near the center of parking lot of the Trail Community Church.

May 17, 2016
S. Beecher
S. Fein

Scott D. Fein
Jackson County Surveyor

P.- 29