

**GCDB 400140**

Quarter corner common to Sections 33 and 34, Township 35 South, Range 2 West, W.M.

**SEE RECORDED SURVEY NO. 2915**


**SEE NEXT PAGE FOR FIRST RE-ESTABLISHMENT**

## FIRST RE-ESTABLISHMENT

GCDB 400140

Quarter corner common to Sections 33 and 34, Township 35 South, Range 2 West, W.M.

At corner location found a 5/8 in. diameter rebar per recorded survey no. 2915, 10 ins. deep in asphalt road surface, placed a 1 x 8 ins. galvanized iron pipe with a 2 ½ ins. brass disc, in concrete with monument case lid flush with road surface, directly over found rebar, brass disc marked:

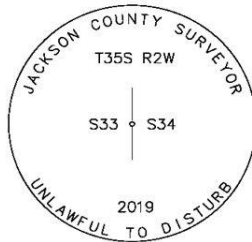

References per recorded survey no. 2915 found:

- 30 ins. diameter oak stump (6 ft high), rotten and leaning southeasterly, no railroad spike found, bears S48°37'30"W, 38.09 feet to center of tree at base. Record: S54°W, 37.24 feet.
- 32 ins. diameter oak, no railroad spike found, bears N89°49'24"E, 67.10 feet to center of tree at base. Record: S85°E, 67.48 feet.

Set new references, 5/8 x 24 ins. rebar with 2 ins. diameter aluminum caps marked "Jackson County Surveyor":

- flush on east side of Table Rock Rd., approx. 50 feet south of driveway to no. 13400, 3 feet east of ditch flowline, bears S15°43'36"E, 107.50 feet.
- flush on east side of Table Rock Rd., approx. 170 feet south of driveway to no. 13400, 1 foot east of ditch flowline, bears S06°58'12"E, 219.31 feet.

Take new references as follows:

- found 5/8 in. diameter rebar per recorded survey no. 6855, 2 ins. deep in concrete fence post base, bears N11°02'21"W, 168.33 feet.
- found 5/8 in. diameter rebar per recorded survey no. 6855, 2 ins. deep, bears N04°03'02"W, 523.86 feet.
- found 5/8 in. diameter rebar with yellow plastic cap marked "LS 1644" per recorded survey no. 12202, exposed 2 ins., leaning southwesterly, bears N30°45'57"E, 95.07 feet.

The First Re-establishment, dated 2019, brass capped center quarter corner to said Section 33, bears S89°58'38"W, 2650.54 feet.

The Third Re-establishment, dated 2019, brass capped northeast section corner to said Section 33, bears N0°47'33"W, 2628.90 feet.

The Third Re-establishment, dated 2019, brass capped southeast section corner to said Section 33, bears S0°47'38"E, 2627.56 feet.

Corner is located near painted centerline stripe of Table Rock Road.

Basis of Bearing: NAD83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-00015

September 18, 2019

O. Ribanszky

J. Hall

Scott Fein

County Surveyor