

FIRST RE-ESTABLISHMENT

GCDB 400200

Corner to Sections 27, 28, 33, and 34, Township 35 South, Range 2 West, W.M.

Found BT White Oak North 45° East, 90.4 feet; also stone marked 28 on Northeast side, lowered stone so top was 24" below surface of ground and set 3 bearing objects, three 1" gas pipes near fence lines which bear:

- North 81°20' West, 202.6 feet.
- South 46°30' West, 111.4 feet.
- South 08°45' East, 207.4 feet.

June 20, 1923

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

GCDB 400200

Section corner common to Sections 27, 28, 33 and 34, Twp. 35 South, Range 2 West, W.M.

Found, 20 ins. below asphalt road surface a 2½ x 1 ins. iron bar, from which:

- A 1 ins. diam. pipe, projecting 1 ins. brs. S08°45'E, 207.42 feet, as noted on first re-establishment, page 4, in 1923.
- A 1 ins. diam. pipe, 4 ins. deep, not visible from corner, recorded as bearing S46°30'W on first re-establishment: I re-measure 111.37 feet.

I set 1 x 36 ins. G.I. pipes with yellow plastic caps marked:

JACKSON

COUNTY

As follows:

- S80°W, 32.40 feet flush.
- N80°E, 91.54 feet projects 1 ins. and is located 5.15 feet S80°W, from nail (head) in shiner in 26 ins. diam. black oak.

Corner lies in center of Table Rock Road, about 100 feet South of P.I. with Highway No. 234.

IN MON CASE

February 7, 1979

B. Malotte

R. Frost

Approved by: Edward McGinty
County Surveyor


SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

GCDB 400200

Section corner common to Sections 27, 28, 33 and 34, Twp. 35 South, Range 2 West, W.M.

Found 8 ins. below asphalt road surface in 4 ins. diameter pvc sleeve, an unrecorded 3 ins. diameter brass cap, marked:

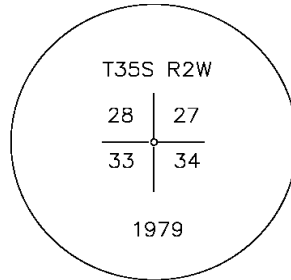

References per Second Re-establishment dated 1979, found:

- 1 ins. diameter iron pipe with yellow plastic cap marked "Jackson County", 2 ins. deep, located approx. 5 feet west of 30 ins. diameter black oak, bears $N79^{\circ}41'06''E$, 91.53 feet. Record: $N80^{\circ}E$, 91.54 feet.
- 1 ins. diameter iron pipe, severely bent northeast, 10 ins. deep. Record: $S80^{\circ}W$, 32.40 feet (not used for this Re-establishment).

Set new references, 5/8 x 24 ins. rebar with 2 ins. diameter aluminum caps marked "Jackson County Surveyor":

- flush, on east side of Table Rock Rd., 3 feet west of northeast-southwest bearing fence line, 27 feet south of power pole, bears $S46^{\circ}23'47''E$, 79.92 feet.
- flush, on east side of Table Rock Rd., 2 feet west of north-south bearing fence line, 120 feet south of fence line angle point, bears $S15^{\circ}10'55''E$, 191.00 feet.
- flush, at southwest corner of Table Rock Rd. and Highway No. 234, 2 feet north of northwest-southeast bearing fence line, bears $S37^{\circ}58'26''W$, 107.42 feet.
- flush, at northwest corner of Table Rock Rd. and Highway No. 234, 5 feet south of fence line angle point (fence line bears northeast-west), bears $N41^{\circ}10'02''W$, 190.03 feet.

Take new reference as follows:

- found 5/8 ins. diameter rebar, 4 ins. deep, bears $N85^{\circ}09'21''E$, 95.12 feet.

Corner is located near approx. physical centerline of Table Rock Rd., approx. 100 feet south of physical centerline of Highway No. 234.

Basis of Bearing: NAD83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-00015

July 11, 2019
O. Ribanszky
J. Hall

Scott Fein
County Surveyor