

SPECIAL CORNER

FIRST RE-ESTABLISHMENT

GCDB 200100


Section corner common to Sections 31 and 32, Township 36 South, Range 1 East and Sections 5 and 6, Township 37 South, Range 1 East of the Willamette Meridian.

Found projecting 1 in., the 1 in. diam. iron pipe reported on Survey No. 2038, dated 1962. Said survey purports the found pipe to have been set by "Lowell Ager",..... " in approximately 1953".

Also Survey No. 2038, records taking four reference trees; three of which are found (with healed double blazes);

- White Oak, 16 ins. diam., brs. N46°30'00"W, 157.52 feet to center of tree near base.
Record: 157.2 feet to blaze.
- White Oak, 17 ins. diam., brs. Record: N15°E, 17.5 feet to estimated face.
- White Oak, 25 ins. diam., brs. S50°15'00"E, 36.68 feet to center of tree near base.
Record: 35.7 feet to blaze.

Replace found 1x24 ins. iron pipe with a 1x30 ins. galvanized iron pipe set 30 ins. in the ground with 2½ ins. diam. Jackson County brass cap marked:

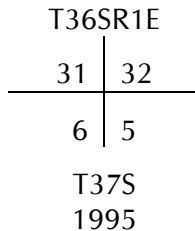

Deposit found pipe alongside corner and marked a new tree "CS" "BT":

- White Oak, 14 ins. diam., brs. S36°49'12"W, 261.00 feet to center of tree at lower blaze.

Corner lies at residence 4975 Antelope Road near intersection of metal post, fence line c. south and S47°W.

Corner lies 1.5 feet N50°W of wood fence post corner of east-west, south, and S68°W bearing fence lines. SMB 8-11-99.

September 5, 1995
R. Frost, Tech.
T. Newcomb, Tech.

Roger Roberts
County Surveyor

P.-51