

## FIRST RE-ESTABLISHMENT

GCDB 100400

Section corner 18 and 19, Township 38 South, Range 1 West, and 13 and 24, Township 38 South, Range 2 West, W.M.

### Found

- Stump of original bearing tree in Section 19, with BT mark entirely legible.
- Also remains of stumps at proper positions in Sections 13 and 24.
- A 1" gas pipe set for corner from which SW corner of house bears: N24°E, 41.5 feet.
- A 24" Black Oak bears S74°W, 5.2 feet.

A. T. Brown,  
Deputy County Surveyor

H. L. Speck, Chainman  
H. Berian, Chainman

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

## SECOND RE-ESTABLISHMENT

GCDB 100400

Section corner on range line. Sections 18 & 19, Township 38 South, Range 1 West and Sections 13 & 24, Township 38 South, Range 2 West.

Found the 1" capped pipe for corner; also the S.W. corner of a two-story wood frame residence to the NE and the remains of a black oak stump to the SW that check OK as reported by County Surveyor, A.T. Brown in 1910.

From the 1" capped pipe for corner:

- The SW corner of the above-mentioned residence bears  $N23\frac{1}{4}^{\circ}E$ , 41.4 feet;
- Center of a 5" Black Walnut tree bears  $N24^{\circ}W$ , 25.3 feet;
- A 22" White Oak scribed CS-BT bears  $S22\frac{1}{4}^{\circ}W$ , 46.6 feet;
- The center of a 6" White Oak bears  $S86\frac{3}{4}^{\circ}E$ , 29.0 feet.

Var:  $19\frac{3}{4}^{\circ}E$ .  
June 1, 1950  
C. Z. Boyden  
M. E. Boyden  
L. D. Pinkham

SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

### THIRD RE-ESTABLISHMENT

GCDB 100400

Section corner common to Sections 13 and 24, Township 38 South, Range 2 West, and Sections 18 and 19, Township 38 South, Range 1 West, W.M.

Found the 1" capped pipe corner monument 6" deep as set for corner on the First Re-establishment by Deputy County Surveyor, A.T. Brown.

From which:

- The center of the Northwest bearing tree described in the Second re-establishment by Deputy County Surveyor, C. Z. Boyden on June 1, 1950 (now a 12" Black Walnut) bears N24°W, 25.3 feet;
- The Southwest corner of the 2-story wood frame residence mentioned in said first and Second Re-establishments bears N23¼°E, 41.4 feet.

Established the following new references:

- The center of a 10" White Oak bears S86¾°E, 48.8 feet;
- Chiseled an "X" on the north end of a 12" concrete culvert which bears S57½°W, 13.94 feet.

January 7, 1970  
F. Roberts,  
Deputy County Surveyor  
D. Phillips

Approved by:  
Mark E. Boyden  
Jackson County Surveyor

SEE NEXT PAGE FOR FOURTH RE-ESTABLISHMENT


## FOURTH RE-ESTABLISHMENT

### GCDB 100400

Section corner common to Sections 18 and 19, Township 38 South, Range 1 West and Sections 13 and 24, Township 38 South, Range 2 West, W.M.

Found the 1-inch diameter capped iron pipe 8 inches deep, reported found on Second Re-establishment, in 1950.

Replaced pipe with a 1x36-inch Galvanized iron pipe set flush with graveled driveway with a 2½-inch diameter brass cap marked:

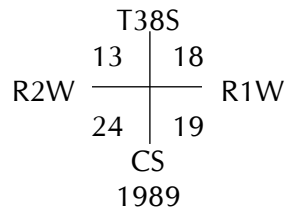

Southwest corner of a 2 story wood frame house bears N23°15'E, 41.34 feet. 1970 Record: 41.4 feet.

Bearing tree recorded on Second Re-establishment in 1950 found:

- Black Walnut 17-inch diameter (unmarked) bears N24°30'W, 25.30 feet to center at base. Record N24°W.

Bearing tree recorded on Third Re-establishment in 1970 found:

- White Oak 14 inches diameter (unmarked) bears Record: S86°45'E, 48.80 feet to center of tree at base.

Marked new reference:

- At the North end of a 12 inches concrete culvert, a small "x" bears S76°30'W, 17.50 feet.

Corner lies on northerly edge of gravel driveway to residence at No. 6165 Pioneer Road and approximately 45 feet Northeast of easterly edge of pavement.

November 7, 1989  
T. Newcomb, Tech.  
S. Beecher, Tech.

Verlyn Thomas  
County Surveyor

P.-220