

FIRST RE-ESTABLISHMENT

DLC66SW

GCDB 866120

Southwest corner of DLC #66, Township 38 South, Range 1 West, W.M.

Found a 2" x 18" iron pipe with a ½" iron pipe. Inside the said 2" pipe for corner, found the remains of the Northwest and Southeast pine BTs underneath the surface of the ground. This corner location has been the recognized corner for 65 years.

Set a 1½" x 35" steel tube 3" below the surface of the road for corner at the exact location of the above mentioned monuments as found.

From which:

- A 12" White Oak scribed CS-BT bears N19°W, 37.9 feet.
- An 8" White Oak scribed CS-BT bears S32°W, 160.9 feet.
- An 8" White Oak scribed CS-BT bears N73½°E, 113.5 feet.
- A 16" White Oak with nail in old blaze (no doubt a previous reference) bears S54°E, 20.2 feet.

November 19, 1953

C. Z. Boyden

L. D. Pinkham

T. Furnas

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

DLC66SW

GCDB 866120

Southwest corner DLC #66, Township 38 South, Range 1 West, W.M.

Found the 1 $\frac{5}{8}$ " steel tube, 4" deep, as set for corner on the First Re-establishment on November 19, 1953.

Replaced said steel tube with a 3" bronze cap, set in a 20" diameter x 14" deep concrete base, 8" deep in a monument case, stamped:

JACKSON COUNTY
T38S R1W
SW | DLC
Cor. | 66
1970
CONTROL MONUMENT

From which:

- A White Oak with scribe "S" showing in the upper blaze and scribe "T" showing in the lower blaze, bears N19°W, 37.75 feet to face of the lower blaze. (1953 Record: 12" White Oak, N19°W, 37.9 feet);
- A 14" White Oak with two healed blazes bears S32°W, 161.2 feet to center of the tree. (1953 Record: 8" White Oak, S32°W, 160.9 feet to the face);
- A 16" White Oak with two healed blazes bears N73 $\frac{1}{2}$ °E, 113.8 feet to center of the tree. (1953 Record: 8" White Oak, N73 $\frac{1}{2}$ °E, 113.5 feet to the face).

March 28, 1972
Lloyd Shreeve
Ray Webber

Approved by:
Mark E. Boyden
County Surveyor

SEE NEXT PAGE FOR THIRD RE-ESTABLISHMENT

THIRD RE-ESTABLISHMENT

DLC66SW

GCDB 866120

Southwest corner to DLC No. 66, located in Section 34, Township 38 South, Range 1 West, W.M.

Found 8 inches deep in monument case, the brass cap in concrete marked:

JACKSON COUNTY
T38S R1W
SW DLC
*
Cor. 66
1970
Control Monument

Set on Second re-establishment dated 1972.

Bearing trees reported in 1972 found and measured to center of trees at lower blaze:

- White Oak, 18-inch diameter, with healed blazes, bears N73°26'E, 113.77 feet. Record: N73½°E, 113.8 feet.
- White Oak, 14-inch diameter, with healed blazes, bears S32°W, 161.47 feet. Record: 161.2 feet.
- White Oak, 14-inch diameter, with healed blazes, bears N19°W, 38.20 feet. Record: 37.75 feet (lower face).

Set new references; 5/8 x 30-inch rebars flush with yellow plastic caps marked: "JACKSON C.S." bear:

- N32°E, 42.76 feet, located 1.5 feet Southwest of fence line.
- N33°26'W, 54.73 feet.

Corner lies in the approach (west) of Adams Road, from Anderson Creek Road.

October 8, 1984
R. Frost
E. McGinty

Edward McGinty
County Surveyor

V = 16°
P. -110

SEE NEXT PAGE FOR FOURTH RE-ESTABLISHMENT

FOURTH RE-ESTABLISHMENT

DLC66SW

GCDB 866120

Southwest corner of Donation Land Claim No. 66, located in Section 34, Township 38 South, Range 1 West, W.M.

From the following found references, set in concrete and flush with the pavement, a 2½-inch diameter brass cap marked:

JACKSON COUNTY SURVEYOR

T38S R1W

DLC

SW 66



2002

Bearing trees and references found or set on Third re-establishment in 1984 found:

- White Oak, now 14-inch diameter with healed blazes, bears N18°55'31"W, 38.20 feet to center of tree at lower blaze. Record: N19 W
- White Oak, now 17-inch diameter with healed blazes, bears N73°29'12"E, 113.77 feet to center of tree at lower blaze. Record: N73°26' E

Rebars with 1½-inch diameter aluminum caps, found flush and marked:

JACKSON COUNTY



SURVEYOR

Bear record:

- N33°26'W, 54.73 feet.
- N32°E, 42.76 feet.

Corner reference taken in 1995, Page 29 of Corner Reference Book, a "P-K" nail found flush in driveway pavement, bears Record: N7°01'23E, 39.73 feet.

Corner lies southwesterly of centerline intersection of Adams and Anderson Creek Roads.

January 25, 2002

H. Durkee

S. Beecher

T. Newcomb

Roger Roberts

Jackson County Surveyor

P. -8

SEE NEXT PAGE FOR FIFTH RE-ESTABLISHMENT


FIFTH RE-ESTABLISHMENT

DLC66SW

GCDB 866120

Southwest corner of Donation Land Claim No. 66, located in Section 34, Township 38 South, Range 1 West, W.M.

Found, set in concrete and 1 in. deep under chip sealed pavement, a 2½ ins. diam. brass cap marked:

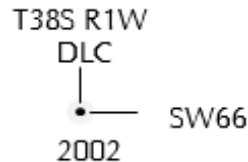

Set on the Fourth Re-establishment, dated 2002.

From which, bearing trees marked on the First Re-establishment, dated 1953, and recorded on the Fourth Re-establishment found:

- White Oak 18 ins. diam. brs. Fourth Re-establishment record N73°29'12"E, 113.77 ft. to center of tree at lower blaze.
- White Oak 15 ins. diam. with healed blazes brs. Fourth Re-establishment record N18°55'31"W, 38.20 ft. to center of tree at lower blaze.

The Northeast pin set on the Third Re-establishment dated 1984, is found bent and missing cap. The Northwest pin set on the Third Re-establishment is not accessible at this time.

Set new references, 5/8 x 24 ins. rebar with 2 ins. diam. aluminum caps marked:

JACKSON COUNTY



SURVEYOR

flush with ground:

- Located at the inside 90° curve on Anderson Crk. Rd. and 3 ft. North of fence brs. S81°07'10"E, 78.47 ft.
- Located 2 ft. Northeast of a 6 ins. x 6 ins. fence post at corner of Northwest and Southwest bearing fence line at the west side of Anderson Crk. Rd. brs. S5°57'22"W, 35.35 ft.

Corner is located in the pavement 14 ft. south of the center of Adams Rd. at a point approx. 50 ft. West of its intersection with Anderson Crk. Rd. and opposite driveway to 1340 Adams Rd.

August 11, 2010
S. Beecher

Kerry K. Bradshaw
County Surveyor


P. - 43
Series II Book I

SEE NEXT PAGE FOR CORNER REPORT

**CORNER REPORT
DLC66SW
GCDB 866120**

Southwest corner of Donation Land Claim No. 66, located in Section 34, Township 38 South, Range 1 West, W.M.

Found, set in concrete and 1 in. deep under chip sealed pavement, a 2-1/2 ins. diam. brass cap per Fifth Re-Establishment, dated 2010. Cap marked:

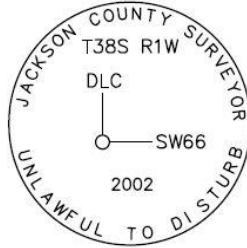

References recorded on fifth Re-establishment found:

- White Oak now 24 ins. diam. with double healed blazes brs. N73°07'10"E, 113.77 ft. record N73°29'12"E, to center of tree at lower blaze.
- White Oak now 16 ins. diam. with double healed blazes brs. N19°18'06"W 38.20 ft. record N18°55'31"W, to center of tree at lower blaze.

5/8 x 24 ins. rebar with 2 ins. diam. aluminum caps flush with ground and marked;

JACKSON COUNTY,
△
SURVEYOR

- Located at the inside 90° curve on Anderson Crk. Rd. and 3 ft. North of fence brs. S81°21'03"E, 78.47 ft. Record S81°07'10"E
- Located 2 ft. Northeast of a 6 ins. x 6 ins. fence post at corner of Northwest and Southwest bearing fence line at the west side of Anderson Crk. Rd. brs. S5°39'39"W, 35.35 ft. Record S5°57'22"W

Corner is located in the pavement 14 ft. south of the center of Adams Rd. at a point approx. 50 ft. West of the intersection with Anderson Crk. Rd. and opposite driveway to 1340 Adams Rd.

Basis of Bearing: NAD 83 2011 Epoch (2010) OCRS GP/ASH zone per OAR 734-005-0015

February 12, 2020
J. Hall
O. Ribanszky

Scott D. Fein
County Surveyor