

GCDB 400200

76.52 Chains

Intersect sectional correction line, 10 links E. of temporary corner of Section 27, 28, 33, and 34.

Set an iron post, 3 feet long, 2-inch diameter, 27 inches in the ground, for corner of Sections 27, 28, 33, and 34, with brass cap marked:

T30S	R2E
S28	S27
<hr/>	
S33	S34
1937	

From which:

- A white fir, 25-inch diameter bears N.52°E., 16 links distance. Marked: T 30 S R 2 E 27 BT.
- A white fir, 50-inch diameter bears S.65°E., 157 links distance. Marked: T 30 S R 2 E 34 BT.
- A fir, 13-inch diameter bears S.23°W., 31 links distance. Marked: T 30 S R 2 E S 33 BT.
- A fir, 38-inch diameter bears N.23°W., 89 links distance. Marked: T 30 S R 2 E S 28 BT.

Surveyed by L. Carter in 1937.


SEE NEXT PAGE FOR FIRST RE-ESTABLISHMENT

FIRST RE-ESTABLISHMENT

GCDB 400200

Section corner common to Sections 27, 28, 33 and 34, Township 30 South, Range 2 East, W.M.
 $V = 18\frac{1}{2}^\circ$

Found projecting 9 inches (23 cm) in M.O.S. the original 2-inch (5 cm) diameter iron pipe with standard GLO brass cap marked:

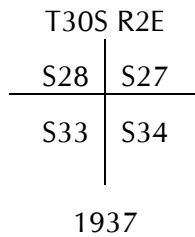

As recorded by L. Carter in 1937.

Original bearing trees found as follows:

- Sawed fir stump, 25-inch (64 cm) diameter bears N48°E, 10.75 feet (3.28 m) to center. Record: N52°E, 10.56 feet (3.22 m).
- Sawed fir stump, 63-inch (160 cm) diameter bears Record: S65°E, 103.62 feet (31.58 m) to center.
- Hemlock, 18-inch (46 cm) diameter, with healed single blaze bears S23°W, 20.15 feet (6.14 m) to center. Record: S23°W, 20.46 feet. (6.24 m)
- Hemlock 41-inch (104 cm) diameter, containing scribe marks including "S 28 BT" in partially healed face bears N23°W, 57.9 feet (17.65 m) to center. Record: N23°W, 58.74 feet (17.90 m).

I marked new trees CS BT and took measurements to center of trees at lower blaze:

- Hemlock, 16-inch (41 cm) diameter bears N24°E, 68.73 feet (20.95m).
- Shasta red fir, 22-inch (56 cm) diameter bears S55°E, 44.90 feet (13.69 m).

Corner lies 54 feet (16.5 m) East of road c S10°E and 56 feet (17.07 m) West of small stream.

August 22, 1978

B. Malotte

R. Frost

Approved by: Edward McGinty
County Surveyor

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SECOND RE-ESTABLISHMENT

GCDB 400200

Section corner common to Sections 27, 28, 33 and 34, Township 30 South, Range 2 East, W.M.

Found the original 2½ ins. diam. brass cap on 2 ins. diam. galvanized iron pipe, set in 1937, protruding 12 ins. and marked:

U.S. GENERAL LAND OFFICE

T30S	R2E
S28	S27
S33	S34

1937

Original bearing trees recorded on the First Re-establishment, dated 1978, found:

- Hemlock, now a burnt stump, bears S24°30'59"W, 20.15 feet; Record: S23°W.
- Hemlock now a burnt stump bears N23°52'06"W, 57.90 feet; Record: N23°W.

Bearing Trees marked on the First Re-establishment found:

- Hemlock, 18 ins. diam., burnt, bears N23°08'59"E, 68.73 feet; Record: N24°E.
- Shasta red fir, 30 ins. diam., burnt, bears S54°38'01"E, 44.90 feet; Record: S55°E.

New references:

- Found 9-inch diameter fir with partially open upper and lower blazes and Jackson County Surveyor bearing tree tag, bears N25°12'01"W, 46.76 feet. See 2008 Field Notes pg. 147-148.
- Set 5/8 ins. diam. rebar with a 2 ins. diam. aluminum cap marked Jackson County Surveyor, bears S71°49'59"W, 41.71 feet.
- Set 5/8 ins. diam. rebar with a 2 ins. diam. aluminum cap marked Jackson County Surveyor, bears S36°40'03"W, 116.88 feet.

Basis of Bearing: NAD 83 2011 Epoch (2010) OCRS GP/ASH zone per 734-005-0015

Corner lies +/- 60 feet East of gravel road and +/- 50 feet Westerly of a small stream.

November 1, 2017

J. Hall

Scott D. Fein
Jackson County Surveyor