


FIRST RE-ESTABLISHMENT

GCDB 700700

Section corner common to Section 36, Township 31 South, Range 4 East, Section 31, Township 31 South, Range 5 East, Section 1, Township 32 South, Range 4 East and Section 6, Township 32 South, Range 5 East, W.M.

At the corner, found projecting 3 inches, the 3-inch diameter iron pipe with 3½-inch diameter standard GLO brass cap marked:

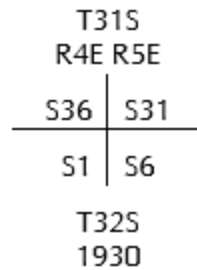

By H. Raymond, in 1930.

An original bearing tree recorded by R. Moore in 1884, now a rotted fir stump approximately 18-inch diameter containing reverse impression of scribed "BT" bears Record: N25°W, 9.24 feet.

Bearing trees marked in 1930 found:

- Fir, now dead, 28-inch diameter containing complete scribing in exposed single face bears as reported on 1937, GLO dependent resurvey; N20°E, 32.34 feet to center of tree.
- Fir snag, 18-inch diameter containing complete scribing in exposed single face bears S62½°E, 54.06 feet to center of tree. Record (1937); 54.78 feet.
- Fir snag, 18-inch diameter, containing complete scribing in exposed single face bears S20°W, 61.05 feet to center of tree. Record (1937); 60.72 feet.

Bearing tree marked in 1937, by the GLO (Carter & Price) found:

- Fir snag, 22-inch diameter, containing complete scribing in exposed single face bears Record: N42°W, 38.28 feet to scribed face.

Marked new trees "CS" "BT" and took measurements to center of trees at lower blaze:

- Hemlock, 7-inch diameter bears N9½°E, 24.00 feet (7.31 m).
- Hemlock, 8-inch diameter bears S73½°E, 16.95 feet (5.16 m).
- Hemlock, 12-inch diameter bears S36°W, 17.33 feet (5.28 m).
- Hemlock, 7-inch diameter bears N59°W, 18.58 feet (5.66 m).

Corner lies on (30%) East slope, about 650 feet West of location marker on 24-inch diameter Hemlock located on the right bank of Varmint Creek c. South and approximately 1500 feet West of Varmint Creek road, c. South and N40°W.

September 11, 1984
R. Frost
B. Malotte

Edward McGinty
County Surveyor

V = 17°
P.-107