

## FIRST RE-ESTABLISHMENT

GCDB 300100

Section corner common to Section 32 and 33, Twp. 34 South, Range 2 East, and Section 4 and 5, Twp. 35 South, Range 2 East, W.M.  $V = 18\frac{1}{2}^\circ$

Set 1x36-inch G.I. pipe 30 ins. in the ground with 2½-inch bronze disc marked:

Jackson County 1976	
T34S	R2E
32	33
-----	
5	4
T35S	

From which, original BTs recorded by N. Ford in 1855 found as follows:

- Down Black Oak, 21-inch diameter, with axed out, healed over faces, the sawed stump of which bears record  $S47^\circ E$ , 36.3 feet to estimated face.
- The base and stump hole of down and rotted Pine core, with old axe work bears record,  $N43^\circ W$ , 9.90 feet.
- Oak sprouts found in area of original S.W. BT.

I mound stones around corner, marked new trees C.S. BT and take measurements to center of trees at lower blaze:

- Douglas Fir, 10-inch diameter, bears  $N66^\circ E$ , 19.21 feet.
- Douglas Fir, 8-inch diameter, bears  $S76^\circ E$ , 28.58 feet.
- Cedar, 6-inch diameter, bears  $S8\frac{1}{2}^\circ W$ , 9.98 feet.
- Douglas Fir, 12-inch diameter, bears  $N71\frac{1}{2}^\circ W$ , 24.40 feet.

Corner lies about 40 feet West of jeep road.

May 4, 1976

B. Malotte

R. Frost

Witness: A. Rambo, Medco Corp.

K. Bradshaw, Medco Corp.


Approved by: Edward McGinty  
County Surveyor

**SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT**

**SECOND RE-ESTABLISHMENT  
GCDB 300100**

Section corner common to Sections 32 and 33, Township 34 South, and Sections 4 and 5, Township 35 South, Range 2 East, W.M.

Found at the corner position, exposed 8 ins. in a mound of stones, the 1 in. diam. galv. iron pipe with a 2½ ins. diam. brass cap set on 1<sup>st</sup> Re-establishment in 1976, marked:

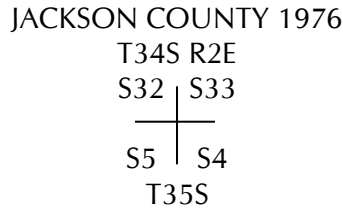

Bearing trees recorded on said 1<sup>st</sup> Re-establishment, found with healed double blazes and measured to center at lower blaze:

- D. Fir high-stump brs. record; N66°E, 19.2 ft.
- D. fir high-stump brs. record; S76°E, 28.6 ft.
- Cedar, now 11 ins. diam. brs. record; S8½°W, 10.0 ft.
- Sawed Fir stump brs. record; N71½°W, 24.4 ft.

Mark new bearing trees "CS" "BT" and take measurements to center of trees at lower blaze:

- Cedar 6 ins. diam. brs. N3¼°W, 10.7 ft.
- D. Fir 5 ins. diam. brs. N80°E, 31.5 ft.
- Cedar 7 ins. diam. brs. S65½°E, 9.0 ft.

Corner lies approx. 50 ft. west of closed jeep road.

October 20, 2011  
H. Durkee

Kerry Bradshaw  
Jackson County Surveyor

P. – 63  
V. – 14°50'