

## FIRST RE-ESTABLISHMENT

GCDB 500200

Section corner to 26, 27, 34 and 35.

Set 2"x36" gas-pipe for corner, Var.  $20^{\circ}05'$ East,.

- A 20" Black Oak scribed CS-BT bears South  $72^{\circ}05'$ West, 180.3 feet.
- An 18" White Oak bears North  $58^{\circ}55'$ West, 191.4 feet.
- Scribed CS-BT the center of 16" Locust unscribed bears North  $29^{\circ}40'$ East, 119.7 feet.
- Set 1"x36" I.P. flush with the surface of the ground which bears South  $37^{\circ}40'$ East, 31.0 feet, near Northeast corner of barn.

November 22, 1927  
Boyden, Deputy County Surveyor  
R. Smith and R. M. Kent, Chainmen

SEE NEXT PAGE FOR SECOND RE-ESTABLISHMENT

SPECIAL CORNER

SECOND RE-ESTABLISHMENT


GCDB 500200

Section corner common to Sections 26, 27, 34 and 35, Township 36 South, Range 4 West. W.M.

Found projecting 3 ins. from concrete slab, the 2 ins. diam. iron pipe, leaning south, set on first re-establishment, page 3, dated 1927. The 1927 (re)establishment does not mention from what evidence, if any, this corner was set. As the above noted pipe is bent and/or disturbed.

I determined the (1927) position from the following references and set a 1 1/2 ins. diam. brass cap marked:

T36S R4W

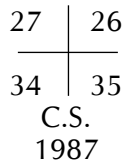

Flush in the above noted concrete slab.

- The top of found (leaning) pipe brs. S30°E, 1.5 feet.

References recorded in 1927 found:

- White Oak, now 26 ins. diam., reported in 1927 as bearing N58°55'W, measures Record: 191.4 feet to estimated face.
- At record location of a (1927) recorded "1"x36" I.P." is found a 1x34 ins. steel axle, 3 ins. deep, with the top 12 ins. bent easterly. Replace this axle with a 5/8x24 ins. rebar, with yellow plastic cap marked "Jackson C.S.", 11 ins. deep, in the vertical hole formerly occupied by the lower (2/3) section of the found axle.
- The rebar is under private (gravel) drive, bordered by concrete curbs and is located 5.8 feet Southeast of the northwest curb and 8.1 feet northwest of southeast curb. Said rebar brs. Record: S37°40'E, 31.00 feet.

**Note:** Survey No. 2955, dated 1965 describes the above as a 1 ins. iron bar, 46.3 lks. distant. This distance (30.56 feet.) was found not to agree with other references.

A bearing tree marked on Survey No. 2955,

- A black oak, now 26 ins. diam., with healed single blaze, brs. Record: S82°30'W, 158.40 feet to center of tree near base.

SECOND RE-ESTABLISHMENT CONTINUED ON NEXT PAGE

sSECOND RE-ESTABLISHMENT (Continued)

GCDB 500200

To perpetuate this location, take new references:

- The top center of concrete "love" fountain, encompassed by heart shape designs, projecting 3 feet from concrete water way in front of gazebo, brs. N41°12'E, 33.92 feet.
- The center, at base, of a 2 ins. diam. steel post, being an angle point in chain link fence, c. S16°E and N30°E, brs. S68°20'E, 39.66 feet.
- The center, at base, of the most easterly apple tree, 4 ins. diam. of a group of (7) fruit trees, brs. S23°09'E, 17.3 feet.
- P-K nail in North side of Light Pole No. R-5070 brs. S60°58'W, 1.43 feet.
- Chiseled cross in concrete walk, located 1.4 feet south of most southerly corner of gazebo foundation, brs. N4°13'W, 22.05 feet.

Corner lies about 4.5 feet Southeast of the bottom of waterway spilling on to water wheel.

July 22, 1987  
R. Frost, Tech III  
S. Beecher, Tech I

Edward McGinty  
County Surveyor

P. -268